



Department of Environmental Protection

Lawton Chiles
Governor

Twin Towers Office Building
2600 Blair Stone Road
Tallahassee, Florida 32399-2400

Virginia B. Wetherell
Secretary

September 23, 1996

Mr. Clark Gamble
President
Carriage Cleaners, Inc.
5675 Seminole Boulevard
Seminole, Florida 34642

Dear Mr. Gamble:

The Department has received the Title V General Permit Notification Form for the dry cleaning facility that you submitted on August 22, 1996.

Please note that in November of each year the Department will be mailing fee notices to those facilities using the Title V general permit. This annual operation fee is \$50 and it is due and payable between January 15 and March 1 of each year the facility is in operation and is subject to the requirements of the Title V general permit.

If you have or expect to have any changes in your mailing address, location address, responsible official, or phone number, please notify the Department at the following address:

Title V General Permits Office
Bureau of Air Monitoring and Mobile Sources MS 5510
Department of Environmental Protection
2600 Blair Stone Road
Tallahassee, Fl 32399-2400

If there are any changes in the facility status, including change of operating parameters or equipment, or if you have any additional questions regarding the Title V General Permit Program, please contact the District or local air program compliance inspector in your area.

Sincerely,

Dotty Diltz, Chief
Bureau of Air Monitoring
and Mobile Sources

/DD

cc: Mr. Gary Robbins, Pinellas County



Jeb Bush
Governor

Department of Environmental Protection

Twin Towers Office Building
2600 Blair Stone Road
Tallahassee, Florida 32399-2400

David B. Struhs
Secretary

June 25, 2001

Mr. Clark A. Gamble
Carriage Cleaners
5675 Seminole Boulevard
Seminole, Florida 33772

Dear Mr. Gamble:

Thank you for your submittal of the Perchloroethylene Dry Cleaners Air General Permit Notification Form. The Department received your submittal on June 22.

In reviewing your submittal, it was noted that Carriage Cleaners elected to surrender its existing Title V air general permit (AIRS ID 1030308). If your intention is to continue your dry cleaning operations, then your existing permit is not to be surrendered and the notification form will need to be corrected. To correct the form, please remove the checkmark next to the "I hereby surrender" statement and initial the change, resign the form on the back and date.

Please return the corrected form as quickly as possible to:

General Permits Section
Bureau of Air Monitoring and Mobile Sources, MS 5510
Department of Environmental Protection
2600 Blair Stone Road
Tallahassee, Florida 32399-2400

If you no longer wish to operate a dry cleaning facility under the Title V air general permit, then your permit may be surrendered. In this case, you need to do nothing and your form will continue to be processed as submitted.

Thank you for your attention to this matter and I apologize for the confusion with this portion of the form.

If you have any questions concerning the form or the corrections, please contact either Rick Butler at 850/921-9586 or me at 840/921-9583.

Sincerely,

A handwritten signature in cursive script, appearing to read "Sandra Bowman".

Sandra Bowman
Bureau of Air Monitoring
and Mobile Sources

SB/
Enclosure
cc: Mr. Gary Robbins, Pinellas County

"More Protection, Less Process"

Printed on recycled paper.

Perchloroethylene Dry Cleaning Facility Notification

Facility Name and Location

1. Facility Owner/Company Name (Name of corporation, agency, or individual owner): Carriage Cleaners^C Inc.
2. Site Name (For example, plant name or number): Carriage Cleaners Inc.
3. Hazardous Waste Generator Identification Number: FLD 049 557 408
4. Facility Location: Street Address: 5675 seminole Blvd. City: Seminole County: Pinellas Zip Code: 34642
5. Facility Identification Number (DEP Use): 1030308

Responsible Official

6. Name and Title of Responsible Official: Clark Gamble president
7. Responsible Official Mailing Address: Organization/Firm: Street Address: City: County: Zip Code:
8. Responsible Official Telephone Number: Telephone: (813) 392 - 2175 Fax: () -

Facility Contact (If different from Responsible Official)

9. Name and Title of Facility Contact (For example, plant manager):
10. Facility Contact Address: Street Address: City: County: Zip Code:
11. Facility Contact Telephone Number: Telephone: () - Fax: () -

RECEIVED
AUG 22 1996
Bureau of Air Monitoring
& Mobile Sources

#1030308

Carriage Cleaners

p.15 5(c) not required, mark out "X"
and initial

Facility Information

1.(a) Provide the information below for each machine at the facility. Indicate the type of machine, the date of its purchase, and the date the control device was installed, if applicable.

Type of Machine	ID	Date Machine Initially Purchased	Date Control Device Installed	ID	Date Machine Initially Purchased	Date Control Device Installed	ID	Date Machine Initially Purchased	Date Control Device Installed
<i>Example</i>	<i>#1</i>	<i>03-OCT-93</i>	<i>12-NOV-93</i>	<i>#2</i>	<i>08-DEC-91</i>		<i>#3</i>	<i>02-MAR-92</i>	<i>02-MAR-92</i>
Dry-to-Dry Unit									
(1) w/ ref. condenser	<i>#1</i>	<i>08Dec90</i>	<i>08Dec90</i>						
(2) w/ carbon adsorber									
(3) w/ no controls									
Washer Unit									
(4) w/ ref. condenser									
(5) w/ carbon adsorber									
(6) w/ no controls									
Dryer Unit									
(7) w/ ref. condenser									
(8) w/ carbon adsorber									
(9) w/ no controls									
Reclaimer Unit									
(10) w/ ref. condenser									
(11) w/carbon adsorber									
(12) w/ no controls									

(b) Control devices are required, but not yet installed

(c) No control devices are required to be installed

2.(a) What was the total quantity of perchloroethylene (perc) purchased in the latest 12 months?

129 gallons

(b) If less than 12 months, how many? months

Check why it is less than 12 months: New owner: New store: Did not keep records:

3. What is the facility's source classification based on the definitions found in section (3) of Part II?

(Indicate with an "X". Select one classification only.)

*existing
Small
None*

Existing small area source

New small area source

Existing large area source

New large area source

4. What control technology is required on machines pursuant to section (5) of Part II of this notification form?
(Indicate with an "X".)

Existing large area source

Carbon adsorber

Refrigerated condenser

New small area source

Refrigerated condenser

New large area source

Refrigerated condenser

5. A facility which contains non-exempt emissions units shall not be eligible to use the general permit pursuant to Rule 62-213.300, F.A.C. Verify that all steam and hot water generating units on-site meet the following exemption criteria or that no such units exist on-site:

All steam and hot water generating units on-site (1) have a total heat input of 10 million BTU/hr or less (298 boiler HP or less), and (2) are fired exclusively by natural gas except for periods of natural gas curtailment during which propane or fuel oil containing no more than one percent sulfur is fired.

All steam and hot water generating units exempt

No such units on-site

Equipment Monitoring and Recordkeeping Information

Check all logs which are required to be kept on-site in accordance with the requirements of this general permit:

(a) Purchase receipts and solvent purchases

(b) Leak detection inspection and repair

(c) Refrigerated condenser temperature monitoring

(d) Carbon adsorber exhaust perc concentration monitoring

(e) Instrument calibration

(f) Start-up, shutdown, malfunction plan

Surrender of Existing Air Permit(s)

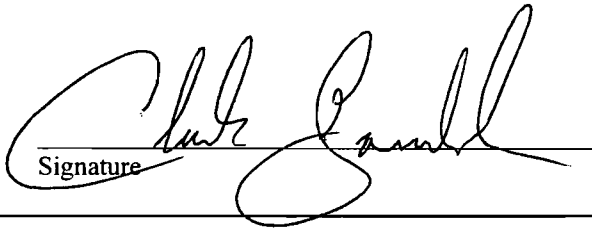
Please indicate with an "X" the appropriate selection:

- I hereby surrender all existing air permits authorizing operation of the facility indicated in this notification form; specifically, permit number(s) _____.
- No air permits currently exist for the operation of the facility indicated in this notification form.

Responsible Official Certification

I, the undersigned, am the responsible official, as defined in Part II of this form, of the facility addressed in this notification. I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, I agree to operate and maintain the air pollutant emissions units and air pollution control equipment described above so as to comply with all terms and conditions of this general permit as set forth in Part II of this notification form.

I will promptly notify the Department of any changes to the information contained in this notification.


Signature

08-17-96
Date

**DRY CLEANER AIR QUALITY GENERAL PERMIT
ANNUAL COMPLIANCE CERTIFICATION FORM**

FACILITY NAME: Carriage Cleaners DATE: 3/13/97
 FACILITY LOCATION: 3675 Seminole Blvd.
Seminole, FL 33772

Annual Reporting Period: March 13, 1996 TO March 13, 1997

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Responsible official shall maintain perchloroethylene purchase records as a rolling average
 Exact period of non-compliance: from March 13, 1996 to March 13, 1997

Action(s) taken to achieve compliance: Official will maintain perchloroethylene purchase records as a rolling average

Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Responsible official shall maintain a weekly leak log.
 Exact period of non-compliance: from March 13, 1996 to March 13, 1997

Action(s) taken to achieve compliance: official will maintain a weekly leak log.

Method used to demonstrate compliance: _____

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon rolling averages of purchase receipts, does not exceed 2,100 gallons per year for dry-to dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: CLARK GAMBLE
 Name (Please Print)

Clark Gamble 3/13/97
 Signature Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

**DRY CLEANER AIR QUALITY GENERAL PERMIT
ANNUAL COMPLIANCE CERTIFICATION FORM**

FACILITY NAME: Carriage Cleaners DATE: 3/13/97
 FACILITY LOCATION: 5695 Seminole Blvd.
Seminole, FL 33772

Annual Reporting Period: March 13, 1996 TO March 13, 1997

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Responsible official shall develop and maintain a startup/shut down for malfunction plan + deviation report
 Exact period of non-compliance: from March 13, 1996 to March 13, 1997

Action(s) taken to achieve compliance: official will develop a startup/shut down for malfunction plan + deviation report

Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon rolling averages of purchase receipts, does not exceed 2,100 gallons per year for dry-to dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: CLARK GAMBLE Clark Gamble 3/13/97
 Name (Please Print) Signature Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

✓

TITLE V AIR QUALITY AIR GENERAL PERMIT INSPECTION SUMMARY REPORT

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

TIME IN: 11:00am	TIME OUT: 11:30 am	AIRS ID# 1030308 001
TYPE OF FACILITY: Perchloroethylene Dry Cleaner		
FACILITY NAME: Carriage Cleaners	DATE: February 18, 1997	
FACILITY LOCATION: 5675 Seminole Blvd., Seminole, FL 34642		
RESPONSIBLE OFFICIAL: Clark Gamble	PHONE NUMBER: 813-392-2175	

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance discrepancies were noted:

COMPLIANCE REQUIREMENT/PROBLEM	FOLLOW-UP ACTION REQUIRED
Monthly purchase records were not maintained as a twelve month rolling average.	Develop and implement a recordkeeping procedure that maintains monthly purchases (perc) as a twelve month rolling average.
Did not have a start-up, shutdown, malfunction (SSM) plan in place, along with associated recordkeeping, on site.	If no specific procedures are available from the manufacturer, develop a SSM plan that describes procedures for maintaining and operating equipment during periods of start-up and shutdown associated with a malfunction. EPA's O&M manual may be used if no manufacturers information is available. Keep log of maintenance actions
Did not maintain a bi-weekly log of leak detection inspection and repair records.	Develop and implement a leak detection inspection and repair program. Maintain a log of leak detection inspection and repair records.

COMMENTS:

The Annual Compliance Certification form has been properly certified and submitted to the inspector. Yes No

DATE OF NEXT INSPECTION: April 14, 1997 (Approximate)

INSPECTION CONDUCTED BY: Jeffrey Morris (Please Print)

INSPECTOR'S SIGNATURE:  PHONE NUMBER: 464-4422

PERCHLOROETHYLENE DRY CLEANERS

TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY
RE-INSPECTION

AIRS ID#: 1030308 TIME IN: 10:20 a.m. TIME OUT: 10:30 a.m.

FACILITY NAME: Carriage Cleaners

FACILITY LOCATION: 5675 Seminole Blvd
Seminole, FL 34642

PART I: NOTIFICATION

(check appropriate box)

- 1. Existing facility notified DARM by 9/1/96
- 2. New facility notified DARM 30 days prior to startup
- 3. Facility failed to notify DARM to use general permit

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(check appropriate box)

- A.
- | | |
|--|--|
| <p>1. Existing small area source <input checked="" type="checkbox"/>
dry-to-dry only, $x < 140$ gal/yr
transfer only, $x < 200$ gal/yr
both types, $x < 140$ gal/yr
(constructed before 12/9/91)</p> | <p>2. New small area source <input type="checkbox"/>
dry-to-dry only, $x < 140$ gal/yr
transfer only, $x < 200$ gal/yr
both types, $x < 140$ gal/yr
(constructed on or after 12/9/91)</p> |
| <p>3. Existing large area source <input type="checkbox"/>
dry-to-dry only, $140 < x < 2,100$ gal/yr
transfer only, $200 < x < 1,800$ gal/yr
both types, $140 < x < 1,800$ gal/yr
(constructed before 12/9/91)</p> | <p>4. New large area source <input type="checkbox"/>
dry-to-dry only, $140 < x < 2,100$ gal/yr
transfer only, $200 < x < 1,800$ gal/yr
both types, $140 < x < 1,800$ gal/yr
(constructed on or after 12/9/91)</p> |

This is a correct facility classification Y N

If no, please check the appropriate classification:

- facility qualified for a general permit as number _____ above
- facility exceeds above limits and is not eligible for a general permit

B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 126 gallons.

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

- 1. Storing perchloroethylene in tightly sealed and impervious containers? Y N
- 2. Examining the containers for leakage? Y N
- 3. Closing and securing machine doors except during loading/unloading? Y N
- 4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? Y N
- 5. Maintaining solvent-to-carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? Y N N/A

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification 1 has been checked, no controls are required. Proceed to Part V.

If classification 2 has been checked, the machine should be equipped with a refrigerated condenser (complete A below).

If classification 3 has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). *Carbon adsorber must have been installed prior to September 22, 1993*

If classification 4 has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below).

A. Has the responsible official of all new sources and existing large area sources:
(check appropriate boxes)

- 1. Equipped all machines with the appropriate vent controls? Y N
- 2. Equipped dry-to-dry machines with a closed-loop vapor venting system? Y N N/A
- 3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? Y N N/A
- 4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a weekly basis? Y N
- 5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45°F? Y N
- 6. Conducted all temperature monitoring after an appropriate cooldown period and after verifying that the coolant had been completely charged? Y N

B. Has the responsible official of an existing large or new large area source also:

- 1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimers, and dryer machines on a weekly basis? Y N

BEST AVAILABLE COPY

2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly?	<input type="checkbox"/> Y <input type="checkbox"/> N
Is the temperature differential equal to or greater than 20° F?	<input type="checkbox"/> Y <input type="checkbox"/> N
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber?	<input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A
Is the perc concentration equal to or less than 100 ppm?	<input type="checkbox"/> Y <input type="checkbox"/> N
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend, contraction, or expansion; and downstream from no other inlet?	<input type="checkbox"/> Y <input type="checkbox"/> N
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils?	<input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A
6. Routed airflow to the carbon adsorber (if used) at all times?	<input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A

Not Applicable

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased?	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
2. Maintained rolling monthly averages of perc consumption?	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
3. Maintained leak detection inspection and repair reports for the following:	
a. documentation of leaks repaired w/in 24 hrs? or;	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt?	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
4. Maintained calibration data? (for direct reading instruments only)	<input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> N/A
5. Maintained exhaust duct monitoring data on perc concentrations?	<input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> N/A
6. Maintained startup/shutdown/malfunction plan?	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
7. Maintained deviation reports?	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
Problem corrected? (No, problems since initial inspection)	<input type="checkbox"/> Y <input type="checkbox"/> N
8. Maintained compliance plan, if applicable?	<input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> N/A

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly leak detection and repair inspection?	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
2. Which method of detection is used by the responsible official?	
Visual examination (condensed solvent on exterior surfaces)	<input checked="" type="checkbox"/>
Physical detection (airflow felt through gaskets)	<input checked="" type="checkbox"/>
Odor (noticeable perc odor)	<input checked="" type="checkbox"/>
Use of direct-reading instrumentation (FID/PID/calorimetric tubes)	<input type="checkbox"/>

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm? Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only)? Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use? Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

3. Has the facility maintained a leak log? Y N

4. The following areas should be checked for leaks by the inspector:

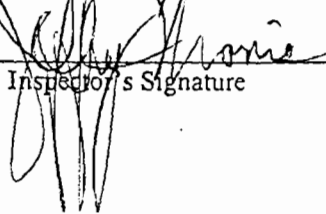
	Leak Detected?			Leak Detected?	
Hose connections, fittings, couplings, and valves	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Muck cookers	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N
Door gaskets and seating	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Stills	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N
Filter gaskets and seating	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Exhaust dampers	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N
Pumps	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Diverter valves	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N
Solvent tanks and containers	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Cartridge filter housings	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N
Water separators	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N			

Clark Gamble

Name of Responsible Official

Jeffrey Morris

Inspector's Name (Please Print)



Inspector's Signature

4/10/97

Date of Inspection

6/1/97

Approximate Date of Next Inspection

ADDITIONAL SITE INFORMATION:

Miraclean 35 lb

Typ DCR G3-025-TF-523

Ser# 89J 541880 Date Mfg: 1989

- Has weekly leak log
- rolling averages and perc receipts maintained
- developed startup, shutdown for malfunction plan.



PERCHLOROETHYLENE DRY CLEANERS

TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY
RE-INSPECTION

AIRS ID#: 1030308 TIME IN: 11:00 a.m. TIME OUT: 11:33 a.m.
 FACILITY NAME: Carriage Cleaners
 FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL 34642

PART I: NOTIFICATION

(check appropriate box)

1. Existing facility notified DARM by 9/1/96
 2. New facility notified DARM 30 days prior to startup
 3. Facility failed to notify DARM to use general permit

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(check appropriate box)

A.	1. Existing small area source dry-to-dry only, $x < 140$ gal/yr transfer only, $x < 200$ gal/yr both types, $x < 140$ gal/yr (constructed before 12/9/91) <input checked="" type="checkbox"/>	2. New small area source dry-to-dry only, $x < 140$ gal/yr transfer only, $x < 200$ gal/yr both types, $x < 140$ gal/yr (constructed on or after 12/9/91) <input type="checkbox"/>
	3. Existing large area source dry-to-dry only, $140 < x < 2,100$ gal/yr transfer only, $200 < x < 1,800$ gal/yr both types, $140 < x < 1,800$ gal/yr (constructed before 12/9/91) <input type="checkbox"/>	4. New large area source dry-to-dry only, $140 < x < 2,100$ gal/yr transfer only, $200 < x < 1,800$ gal/yr both types, $140 < x < 1,800$ gal/yr (constructed on or after 12/9/91) <input type="checkbox"/>

This is a correct facility classification Y N

If no, please check the appropriate classification:

facility qualified for a general permit as number _____ above
 facility exceeds above limits and is not eligible for a general permit

B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 120 gallons.

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

- | | |
|---|---|
| 1. Storing perchloroethylene in tightly sealed and impervious containers? | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N |
| 2. Examining the containers for leakage? | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N |
| 3. Closing and securing machine doors except during loading/unloading? | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N |
| 4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N |
| 5. Maintaining solvent-to-carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? | <input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> N/A |

Non Applicable

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification 1 has been checked, no controls are required. Proceed to Part V.

If classification 2 has been checked, the machine should be equipped with a refrigerated condenser (complete A below).

If classification 3 has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). *Carbon adsorber must have been installed prior to September 22, 1993*

If classification 4 has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below).

A. Has the responsible official of all new sources and existing large area sources:
(check appropriate boxes)

- | | |
|--|--|
| 1. Equipped all machines with the appropriate vent controls? | <input type="checkbox"/> Y <input type="checkbox"/> N |
| 2. Equipped dry-to-dry machines with a closed-loop vapor venting system? | <input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A |
| 3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? | <input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A |
| 4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a weekly basis? | <input type="checkbox"/> Y <input type="checkbox"/> N |
| 5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45°F? | <input type="checkbox"/> Y <input type="checkbox"/> N |
| 6. Conducted all temperature monitoring after an appropriate cooldown period and after verifying that the coolant had been completely charged? | <input type="checkbox"/> Y <input type="checkbox"/> N |

B. Has the responsible official of an existing large or new large area source also:

- | | |
|--|---|
| 1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? | <input type="checkbox"/> Y <input type="checkbox"/> N |
|--|---|

Non Applicable

2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly?	<input type="checkbox"/> Y <input type="checkbox"/> N
Is the temperature differential equal to or greater than 20° F?	<input type="checkbox"/> Y <input type="checkbox"/> N
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber?	<input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A
Is the perc concentration equal to or less than 100 ppm?	<input type="checkbox"/> Y <input type="checkbox"/> N
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend, contraction, or expansion; and downstream from no other inlet?	<input type="checkbox"/> Y <input type="checkbox"/> N
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils?	<input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A
6. Routed airflow to the carbon adsorber (if used) at all times?	<input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased?	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
2. Maintained rolling monthly averages of perc consumption?	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
3. Maintained leak detection inspection and repair reports for the following:	
a. documentation of leaks repaired w/in 24 hrs? or;	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt?	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
4. Maintained calibration data? <i>(for direct reading instruments only)</i>	<input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> N/A
5. Maintained exhaust duct monitoring data on perc concentrations?	<input type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> N/A
6. Maintained startup/shutdown/malfunction plan?	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
7. Maintained deviation reports?	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
Problem corrected? <i>(No deviation report)</i>	<input type="checkbox"/> Y <input type="checkbox"/> N
8. Maintained compliance plan, if applicable?	<input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> N/A

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly leak detection and repair inspection?	<input checked="" type="checkbox"/> Y <input checked="" type="checkbox"/> N <i>Yr</i>
2. Which method of detection is used by the responsible official?	
Visual examination (condensed solvent on exterior surfaces)	<input checked="" type="checkbox"/>
Physical detection (airflow felt through gaskets)	<input checked="" type="checkbox"/>
Odor (noticeable perc odor)	<input checked="" type="checkbox"/>
Use of direct-reading instrumentation (FID/PID/calorimetric tubes)	<input type="checkbox"/>

official verbally stated that leaks are checked, no log or records

Non Applicable

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm? Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only)? Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use? Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

3. Has the facility maintained a leak log? Y N

4. The following areas should be checked for leaks by the inspector:

	Leak Detected?		Leak Detected?	
Hose connections, fittings, couplings, and valves	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Muck cookers	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
Door gaskets and seating	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Stills	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
Filter gaskets and seating	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Exhaust dampers	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
Pumps	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Diverter valves	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
Solvent tanks and containers	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N	Cartridge filter housings	<input type="checkbox"/> Y <input checked="" type="checkbox"/> N
Water separators	<input type="checkbox"/> Y	<input checked="" type="checkbox"/> N		

Clack Gamble

Name of Responsible Official

Jeffrey Morris

Inspector's Name (Please Print)

Inspector's Signature

2/18/97

Date of Inspection

3/5/97 4/14/97

Approximate Date of Next Inspection

ADDITIONAL SITE INFORMATION:

Miraclean 35lb.
Typ DCRG3-0250-TFS-523
Ser. # 89J 541880 Date Mfg: 1987

- ~~No leak log in~~ No weekly leak log.
- No rolling average of perc purchase.
- No startup/shutdown malfunction plan.
- Facility has perchloroethylene waste removed by contracted hazardous waste removal company.

✓

TITLE V AIR QUALITY AIR GENERAL PERMIT INSPECTION SUMMARY REPORT

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

TIME IN: 9:32 a.m.	TIME OUT: 10:00 a.m.	AIRS ID# 1030308 001
TYPE OF FACILITY: Perchloroethylene Dry Cleaner		
FACILITY NAME: Carriage Cleaners	DATE: February 4, 1998	
FACILITY LOCATION : 5675 Seminole Blvd., Seminole, FL 34642		
RESPONSIBLE OFFICIAL: Clark Gamble		PHONE NUMBER:

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance discrepancies were noted:

COMPLIANCE REQUIREMENT/PROBLEM	FOLLOW-UP ACTION REQUIRED
Monthly purchase records were not maintained as a twelve month rolling average.	Develop and implement a recordkeeping procedure that maintains monthly purchases (perc) as a twelve month rolling average.
Did not maintain a log of leak detection inspection and repair records.	Develop and implement a leak detection inspection and repair program. Maintain a log of leak detection inspection and repair records.

Comments:

Facility will need to install a temperature sensor on the outlet exhaust of the refrigerated condenser and will need to maintain weekly logs. In addition, the facility will need to maintain weekly leak logs. The facility is now classified as an Existing Large Area Source.

The Annual Compliance Certification form has been properly certified and submitted to the inspector. Yes No

DATE OF NEXT INSPECTION: February 18, 1998
(Approximate)

INSPECTION CONDUCTED BY: Jeff Morris
(Please Print)

INSPECTOR'S SIGNATURE:  PHONE NUMBER: 464-4422

Alle

DRY CLEANER AIR QUALITY GENERAL PERMIT ANNUAL COMPLIANCE CERTIFICATION FORM

AIRS ID#1030308
CARRIAGE CLEANERS INC CLARK GAMBLE 5675 SEMINOLE BLVD SEMINOLE FL 34642

Do **NOT** Remove Label

Annual Reporting Period: _____ 19 97 TO _____ 19 98

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

RECEIVED

JAN 21 1998

Bureau of Air Monitoring
& Mobile Sources

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon purchase receipts, does not exceed 2,100 gallons per year for dry-to dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: CLARK GAMBLE
Name (Please Print)

Clark Gamble
Signature

1/12/98
Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

Carriage Cleaners

p.15 5(c) not required, mark out "X" and initial

RECEIVED
SEP 25 1996
AIR QUALITY

1. Facility Name		
2. Site Name		
3. Hazardous Waste		
4. Facility Street Address		
5. Facility City		2
6. Name		
7. Responsible Organization		
8. Responsible Telephone		
9. Name and Title of Facility Contact (for example, plant manager):		
10. Facility Contact Address: Street Address: City: County: Zip Code:		
11. Facility Contact Telephone Number: Telephone: () - Fax: () -		

Handwritten signature

RECEIVED
AUG 22 1996
Bureau of Air Monitoring
& Mobile Sources

Perchloroethylene Dry Cleaning Facility Notification

Facility Name and Location

1. Facility Owner/Company Name (Name of corporation, agency, or individual owner): Carriage Cleaners ^C Inc.
2. Site Name (For example, plant name or number): Carriage Cleaners Inc.
3. Hazardous Waste Generator Identification Number: FLD 049 557 408
4. Facility Location: Street Address: 5075 seminole Blvd. City: Seminole County: Pinellas Zip Code: 34642
5. Facility Identification Number (DEP Use): 1030308

Responsible Official

6. Name and Title of Responsible Official: Clark Gamble president
7. Responsible Official Mailing Address: Organization/Firm: Street Address: City: County: Zip Code:
8. Responsible Official Telephone Number: Telephone: (813) 392 - 2175 Fax: () -

Facility Contact (If different from Responsible Official)

9. Name and Title of Facility Contact (For example, plant manager):
10. Facility Contact Address: Street Address: City: County: Zip Code:
11. Facility Contact Telephone Number: Telephone: () - Fax: () -

RECEIVED

AUG 22 1996

Bureau of Air Monitoring
& Mobile Sources

Facility Information

1.(a) Provide the information below for each machine at the facility. Indicate the type of machine, the date of its purchase, and the date the control device was installed, if applicable.

Type of Machine	ID	Date Machine Initially Purchased	Date Control Device Installed	ID	Date Machine Initially Purchased	Date Control Device Installed	ID	Date Machine Initially Purchased	Date Control Device Installed
<i>Example</i>									
	#1	03-OCT-93	12-NOV-93	#2	08-DEC-91		#3	02-MAR-92	02-MAR-92
Dry-to-Dry Unit									
(1) w/ ref. condenser	#1	08Dec90	08Dec90						
(2) w/ carbon adsorber									
(3) w/ no controls									
Washer Unit									
(4) w/ ref. condenser									
(5) w/ carbon adsorber									
(6) w/ no controls									
Dryer Unit									
(7) w/ ref. condenser									
(8) w/ carbon adsorber									
(9) w/ no controls									
Reclaimer Unit									
(10) w/ ref. condenser									
(11) w/carbon adsorber									
(12) w/ no controls									

(b) Control devices are required, but not yet installed

(c) No control devices are required to be installed

2.(a) What was the total quantity of perchloroethylene (perc) purchased in the latest 12 months?

gallons

(b) If less than 12 months, how many? months

Check why it is less than 12 months: New owner: New store: Did not keep records:

3. What is the facility's source classification based on the definitions found in section (3) of Part II?

(Indicate with an "X". Select one classification only.)

Existing small area source

New small area source

Existing large area source

New large area source

4. What control technology is required on machines pursuant to section (5) of Part II of this notification form? (Indicate with an "X".)

Existing large area source

Carbon adsorber

Refrigerated condenser

New small area source

Refrigerated condenser

New large area source

Refrigerated condenser

5. A facility which contains non-exempt emissions units shall not be eligible to use the general permit pursuant to Rule 62-213.300, F.A.C. Verify that all steam and hot water generating units on-site meet the following exemption criteria or that no such units exist on-site:

All steam and hot water generating units on-site (1) have a total heat input of 10 million BTU/hr or less (298 boiler HP or less), and (2) are fired exclusively by natural gas except for periods of natural gas curtailment during which propane or fuel oil containing no more than one percent sulfur is fired.

All steam and hot water generating units exempt
No such units on-site

Equipment Monitoring and Recordkeeping Information

Check all logs which are required to be kept on-site in accordance with the requirements of this general permit:

- (a) Purchase receipts and solvent purchases
- (b) Leak detection inspection and repair
- (c) Refrigerated condenser temperature monitoring *CS 2/18/97*
- (d) Carbon adsorber exhaust perc concentration monitoring
- (e) Instrument calibration
- (f) Start-up, shutdown, malfunction plan

Surrender of Existing Air Permit(s)

Please indicate with an "X" the appropriate selection:

I hereby surrender all existing air permits authorizing operation of the facility indicated in this notification form; specifically, permit number(s) _____

No air permits currently exist for the operation of the facility indicated in this notification form.

Responsible Official Certification

I, the undersigned, am the responsible official, as defined in Part II of this form, of the facility addressed in this notification. I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, I agree to operate and maintain the air pollutant emissions units and air pollution control equipment described above so as to comply with all terms and conditions of this general permit as set forth in Part II of this notification form.

I will promptly notify the Department of any changes to the information contained in this notification.

Chad Gamm
Signature _____ Date 08-17-96
Changes were made on 2/18/97

✓

**PERCHLOROETHYLENE DRY CLEANERS
TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST**

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

AIRS ID#: 0308 001 DATE: 2/4/98 TIME IN: 9:32 a.m. TIME OUT: 10:00 a.m.

FACILITY NAME: Carriage Cleaners

FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL

RESPONSIBLE OFFICIAL: Mr. Clark Gamble Phone No.: 813-392-2175

Permit No. 1030308-001-AG Exp. Date: 09/10/2001

PART I: NOTIFICATION

(Check appropriate box)

1. Existing facility notified DARM by 9/1/96

2. New facility notified DARM 30 days prior to startup

3. Facility failed to notify DARM to use general permit

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(Check appropriate box)

<p>A.</p> <p>1. Existing small area source <input checked="" type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed before 12/9/91)</p> <p>3. Existing large area source <input type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed before 12/9/91)</p>	<p><input type="checkbox"/> No notification form</p> <p><input type="checkbox"/> Drop store / out of business / petroleum</p> <p>2. New small area source <input type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed before 12/9/91)</p> <p>4. New large area source <input type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed before 12/9/91)</p>
---	--

This is a correct facility classification: Y N Can not determine

If no, please check the appropriate classification:

facility qualified for a general permit as number 3 above

facility exceeds above limits and is not eligible for a general permit

B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 146.4 gallons. (Nov. 97) has been over 140 gal. since July 97

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

1. Storing perchloroethylene in tightly sealed and impervious containers? Y N
2. Examining the containers for leakage? Y N
3. Closing and securing machine doors except during loading/unloading? Y N
4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? Y N
5. Maintaining solvent-to- carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? Y N NA

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification (1) has been checked, no controls are required. Proceed to Part V.

If classification (2) has been checked, the machine should be equipped with a refrigerated condenser (complete A below)

If classification (3) has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). Carbon adsorber must have been installed prior to September 22, 1993.

If classification (4) has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below.)

A. Has the responsible official of all new sources and existing large area sources: (check appropriate boxes)

- Mach__ Mach__
1. Equipped all machines with the appropriate vent controls? Y N Y N
 2. Equipped dry-to-dry machines with a closed-loop vapor venting system? Y N Y N
 3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? Y N Y N
 4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a weekly basis? Y N Y N
 5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45°F? Y N Y N
 6. Conducted all temperature monitoring after an appropriate cooldown period and after verifying the coolant had been completely charged? Y N Y N

B. Has the responsible official of an existing large or new large area source also:

1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? Y N
2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly?
Is the temperature differential equal to or greater than 20° F? Y N
 Y N
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber?
Is the perc concentration equal to or less than 100 ppm? Y N NA
 Y N
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend contraction, or expansion; and downstream from no other inlet? Y N NA
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils? Y N NA
6. Routed airflow to the carbon adsorber (if used) at all times? Y N NA

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased? Y N
2. Maintained rolling monthly averages of perc consumption? Y N
3. Maintained leak detection inspection and repair reports for the following:
- a. documentation of leaks repaired w/in 24 hrs? or; Y N
 - b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt? Y N
4. Maintained calibration data? (for direct reading instrument only) Y N NA
5. Maintained exhaust duct monitoring data on perc concentrations? Y N N/A
6. Maintained startup/shutdown/malfunction plan? Y N
7. Maintained deviation reports?
Problem corrected? Y N N/A
8. Maintained compliance plan, if applicable? Y N NA

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly leak detection and repair inspection? Y N

2. Which method of detection is used by the responsible official?

Visual examination (condensed solvent of exterior surfaces)

Physical detection (airflow felt through gaskets)

Odor (noticeable perc odor)

Use of direct-reading instrumentation (FID/PID/calorimetric tubes)

If using direct-reading instrumentation, is the equipment:

a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm. Y N

b. Calibrated against a standard gas prior to and after each use (PID/FID only). Y N

c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N

d. Kept in a clean and secure area when not in use. Y N

e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

3. Has the facility maintained a leak log? Y N

4. The following area should be checked for leaks by the inspector:

Hose connections, fitting couplings, and valves	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Muck cookers	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
---	--	--------------	--

Door gaskets and seating	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Stills	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
--------------------------	--	--------	--

Filter gaskets and seating	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Exhaust dampers	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
----------------------------	--	-----------------	--

Pumps	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Diverter valves	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
-------	--	-----------------	--

Solvent tanks and containers	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N	Cartridge Filter housing	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N
------------------------------	--	--------------------------	--

Water separators	<input checked="" type="checkbox"/> Y <input type="checkbox"/> N		
------------------	--	--	--

Clark Gamble
Name of Responsible Official

Jeff Morris
Inspector's Name (Please Print)

Jeff Morris
Inspector's Signature

2/4/98
Date of Inspection

2/18/98
Approximate Date of Next Inspection

ADDITIONAL SITE INFORMATION:

Machine #1:

Manufacturer Miraclean Capacity 35 lbs
Model# Typ DGR63-0250 Serial# TFS-523 89J 541930 Mfg yr 1989

Machine #2:

Manufacturer _____ Capacity _____ lbs
Model# _____ Serial# _____ Mfg yr _____

Notification (unpermitted sources only):

- 1. Was the facility assisted in filling out the notification by the inspector? Y N N/A
- 2. Did the facility insist on filling out its own notification, and will send it to FDEP? Y N N/A

Record keeping :

- 1. Does facility have statement/specs as to the design accuracy of the temperature sensor? Y N N/A
(temperature of 45°F w/accuracy ±2°F, or 7.2°C w/accuracy of ±1.1°C)

Hazardous Waste:

- 1. Is all perc. contaminated wastewater either treated or disposed of properly? Y N
- 2. If wastewater is evaporated, is it an approved system, and using carbon filtration? Y N N/A
- 3. Does the facility have secondary containment for the dry-dry machine? Y N
- 4. Does the facility have secondary containment for any perc. waste containers? Y N

Boiler:

Manufacturer _____ Hp _____
Model # _____ Serial # _____ Mfg yr _____
Fuel Type: Natural gas? propane? fuel oil?

Comments: Did not maintain leak log, last reported 9/3/97. Did not maintain rolling average, last report 11/97 1464 gallons. Over 140 gallons since July 97 July 97, 141.3, Aug. 141.3, Sep 166.4, Oct 166.4, Nov 146.4 Dec missing. Facility over 140 gallons for 5 months. operator, Clark Gamble stated condenser coil problems had existed, repair receipt indicates repair on 10/16/97 (contractor Linsey Refrigeration + Air Conditioning, Inc.)

ADDITIONAL SITE INFORMATION:

Facility will need to install temperature sensor on outlet exhaust side of the refrigerated condenser and to maintain weekly leak log & weekly temperature sensor log. Facility in noncompliance for not maintaining leak log and rolling monthly total.

✓
all
**DRY CLEANER AIR QUALITY GENERAL PERMIT
ANNUAL COMPLIANCE CERTIFICATION FORM**

AIRS ID#1030308
CARRIAGE CLEANERS INC
CLARK GAMBLE
5675 SEMINOLE BLVD
SEMINOLE FL 34642

RECEIVED
AUG 12 1998
Bureau of Air Monitoring
& Mobile Sources

Do NOT Remove Label

Annual Reporting Period: February 4, 1997 TO February 4, 1998

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

No 12 month consecutive per total

Exact period of non-compliance: from July 1, 1997 to February 4, 1998

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

No leak log

Exact period of non-compliance: from September 3, 1997 to February 4, 1998

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

Bureau of Air Monitoring
& Mobile Sources

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon purchase receipts, does not exceed 2,100 gallons per year for dry-to dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: CLARK GAMBLE
Name (Please Print)

Clark Gamble
Signature

1/12/98
Date

CLARK GAMBLE

6/15/98

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

✓

TITLE V AIR QUALITY AIR GENERAL PERMIT INSPECTION SUMMARY REPORT

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

AIRS ID#: <u>1030308 001</u>	DATE: <u>6/15/98</u>	TIME IN: <u>11:35am</u>	TIME OUT: <u>11:40am</u>
FACILITY NAME: <u>Carriage Cleaners</u>			
FACILITY LOCATION: <u>5675 Seminole Blvd.</u>			
		<u>Seminole, FL, 34642</u>	
RESPONSIBLE OFFICIAL: <u>Clark Gamble</u>		Phone: <u>813-392-2175</u>	
Permit No. <u>1030308-001-AG</u> Exp. Date: <u>09/10/2001</u>			

RECEIVED
 AUG 13 1998
 Bureau of Air Monitoring
& Mobile Sources

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance **discrepancies** were noted (only items which are checked):

Inspection Summary Report Guidance

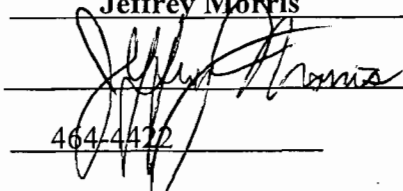
Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/> Did not have a start-up, shutdown, malfunction (SSM) plan in place, along with associated recordkeeping, on site.	If no specific procedures are available from the manufacturer, develop a SSM plan that describes procedures for maintaining and operating equipment during periods of start-up and shutdown associated with a malfunction. EPA's O&M manual may be used if no manufacturer's information is available. Keep log of maintenance actions
<input type="checkbox"/> Purchase receipts were not maintained properly.	Maintain all purchase receipts in a log kept on-site for determination of perchloroethylene solvent consumption.
<input type="checkbox"/> Monthly purchase records were not maintained as a consecutive twelve month total.	Develop and implement a recordkeeping procedure that maintains monthly purchases (perc) as a consecutive twelve month total.
<input type="checkbox"/> Could not confirm that temperature sensor was designed to measure 45°F with an accuracy of ±2°F.	Obtain verification from the manufacturer that the temperature sensor is designed to measure 45°F with an accuracy of ±2°F, or determine this by another method that the Department would consider appropriate.
<input type="checkbox"/> Evaporator for separator wastewater does not incorporate a pre-filtration system.	Facility may choose to either dispose of perc-containing separator water as hazardous waste, or incorporate a carbon filtration system with the evaporator (as per the State's guidelines).
<input type="checkbox"/> Did not store all perc, and perc-containing waste in tightly sealed containers.	Store all perc and perc-containing waste in tightly sealed containers which are impervious and chemically unreactive to the solvent.
<input type="checkbox"/> Did not maintain a log of leak detection inspection and repair records.	Develop and implement a leak detection inspection and repair program. Maintain a log of leak detection inspection and repair records.

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not conduct weekly leak detection and repair inspection.	Develop and implement a leak detection inspection and repair program. Use at least one of the methods outlined in Part II, Section 7(a), of the general permit provisions, to detect leaks. Inspect the items listed in Part II, Section 7(b), for leaks. Repair leaks within 24 hours of detection, unless repair equipment must be ordered.
<input type="checkbox"/>	No calibration records for the mechanical direct reading instrumentation (halogen detector) were available.	Mechanical direct-reading instrumentation shall be operated as directed by the manufacturer and must meet the conditions in Part II, Section 7(e) of the general permit provisions..
<input type="checkbox"/>	Did not measure and record the outlet temperature of the refrigerated condenser on the dry-to-dry machine (dryer, reclaimer) on a weekly basis.	Develop and implement a monitoring program. Measure and record the outlet temperature on a weekly basis. The temperature, measured at the end of the drying cycle, must not exceed 45°F.
<input type="checkbox"/>	Airflow is directed towards the refrigerated condenser upon the door being opened and no diverter valve is in place.	Equip the condenser with a diverter valve to prevent air flow to the refrigerated condenser when the door is opened.
<input type="checkbox"/>	The outlet exhaust temperature of the refrigerated condenser exceeds 45°F and was not repaired within 24 hours.	Repair or adjust condenser within 24 hours of measurement indicating that the outlet exhaust temperature of the refrigerated condenser exceeds 45°F. The repair shall be documented in the monitoring record log.
<input type="checkbox"/>	Machine doors are not closed and secure during times other than loading and unloading.	Keep doors closed and secured at all times except during loading and unloading.
<input type="checkbox"/>	Temperature monitoring was not conducted after an appropriate cooldown period and after verifying that the coolant was completely charged.	Conduct all temperature monitoring following an appropriate cooldown period and after verifying that the coolant has been completely charged.
<input type="checkbox"/>	Containers for perchloroethylene and/or perchloroethylen-containing waste were found to be leaking.	Examine the containers, used for storing perchloroethylene and/or perchloroethylene-containing waste, for leakage.
<input type="checkbox"/>		
<input type="checkbox"/>		

Comments: _____

If the Inspection Summary Report indicates follow-up actions are required, you must take immediate corrective measures to achieve compliance. Pinellas County will perform a follow-up inspection to determine that proper corrective actions have been taken.

Inspection Conducted by: Jeffrey Morris

Inspector's Signature: 

Phone Number: 464-4422

**PERCHLOROETHYLENE DRY CLEANERS
TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST**

TYPE OF INSPECTION: ANNUAL RE-INSPECTION COMPLAINT/DISCOVERY

AIRS ID#: <u>1030308 001</u>	DATE: <u>6/15/98</u>	TIME IN: <u>11:35a</u>	TIME OUT: <u>11:40a.m.</u>
FACILITY NAME: <u>Carriage Cleaners</u>			
FACILITY LOCATION: <u>5675 Seminole Blvd.</u>			
<u>Seminole, FL, 34642</u>			
RESPONSIBLE OFFICIAL: <u>Clark Gamble</u>		PHONE: <u>813-382-1175</u>	
CONTACT: <u>Clark Gamble</u>		PHONE: <u>392-2115</u>	

RECEIVED
AUG 12 1998
Bureau of Air Monitoring
& Mobile Sources

PART I: NOTIFICATION

(Check appropriate box)

1. Existing facility notified DARM By 9/1/96	<input checked="" type="checkbox"/>
2. New facility notified DARM 30 days prior to startup	<input type="checkbox"/>
3. Facility failed to notify DARM to use general permit	<input type="checkbox"/>

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(Check appropriate box)

<p>A.</p> <p>1. Existing small area source <input type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed before 12/9/91)</p> <p>3. Existing large area source <input checked="" type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed before 12/9/91)</p>	<p><input type="checkbox"/> No notification form</p> <p><input type="checkbox"/> Drop store / out of business / petroleum</p> <p>2. New small area source <input type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed on or after 12/9/91)</p> <p>4. New large area source <input type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed on or after 12/9/91)</p>
---	--

This is a correct facility classification: Y N Can not determine

If no, please check the appropriate classification:

facility qualified for a general permit as number _____ above

facility exceeds above limits and is not eligible for a general permit

B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 142 gallons.

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

1. Storing perchloroethylene in tightly sealed and impervious containers? Y N NA
2. Examining the containers for leakage? Y N NA
3. Closing and securing machine doors except during loading/unloading? Y N
4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? Y N NA
5. Maintaining solvent-to-carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? Y N NA

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification (1) has been checked, no controls are required. Proceed to Part V.

If classification (2) has been checked, the machine should be equipped with a refrigerated condenser (complete A below)

If classification (3) has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). Carbon adsorber must have been installed prior to September 22, 1993.

If classification (4) has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below.)

A. Has the responsible official of all new sources and existing large area sources: (check appropriate boxes)

1. Equipped all machines with the appropriate vent controls? Y N
2. Equipped dry-to-dry machines with a closed-loop vapor venting system? Y N NA
3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? Y N NA
4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a weekly/bi-weekly basis? Y N
5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45° F? Y N NA
6. Conducted all temperature monitoring after an appropriate cool down period and after verifying the coolant had been completely charged? Y N

B. Has the responsible official of an existing large or new large area source also:

1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? Y N
2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly? Y N NA
Is the temperature differential equal to or greater than 20° F? Y N NA
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber? Y N NA
Is the perc concentration equal to or less than 100 ppm? Y N NA
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc. concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend contraction, or expansion; and downstream from no other inlet? Y N NA
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils? Y N NA
6. Routed airflow to the carbon adsorber (if used) at all times? Y N NA

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased? Y N
2. Maintained rolling monthly averages of perc consumption? Y N
3. Maintained leak detection inspection and repair reports for the following:
- a. documentation of leaks repaired w/in 24 hrs? or; Y N NA
 - b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt? Y N NA
4. Maintained calibration data? (for direct reading instrument only) Y N NA
5. Maintained exhaust duct monitoring data on perc concentrations? Y N NA
6. Maintained startup/shutdown/malfunction plan? Y N
7. Maintained deviation reports? (no problems with machine) Y N NA
Problem corrected? Y N NA
8. Maintained compliance plan, if applicable? Y N NA

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly (for small sources, bi-weekly) leak detection and repair inspection? Y N

2. Has the facility maintained a leak log? Y N

3. Does the responsible official check the following areas for leaks:

- | | | | |
|---|--|--------------------------|--|
| Hose connections, fitting couplings, and valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Muck cookers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Door gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Stills | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Filter gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Exhaust dampers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Pumps | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Diverter valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Solvent tanks and containers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Cartridge Filter housing | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Water separators | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | | |

4. Which method of detection is used by the responsible official?
- Visual examination (condensed solvent of exterior surfaces)
 - Physical detection (airflow felt through gaskets)
 - Odor (noticeable perc odor)
 - Use of direct-reading instrumentation (FID/PID/calorimetric tubes)
 - Halogen leak detector

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm. Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only). Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use. Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

Jeff Morris
Inspector's Name (Please Print)

6/15/98
Date of Inspection

[Signature]
Inspector's Signature

1/25/99
Approximate Date of Next Inspection

ADDITIONAL SITE INFORMATION:

Reinspected following consent order, in compliance.
Facility was inspected to verify compliance.

FACILITY DETAILS:

FACILITY NAME: Carriage Cleaners

Dry Cleaning Machine #1:

Manufacturer Miraclean Capacity 35 lbs
Model# Typ DERG3-0200 Serial# 89J541880 Mfg yr 1989

RECEIVED
AUG 12 1998
Bureau of Air Monitoring
& Mobile Sources

Dry Cleaning Machine #2:

Manufacturer _____ Capacity _____ lbs
Model# _____ Serial# _____ Mfg yr _____

Boiler:

Manufacturer _____ Hp _____
Model # _____ Serial # _____ Mfg yr _____
Fuel Type: Natural gas? propane? fuel oil?
Not Checked

Notification (unpermitted sources only):

- 1. Was the facility assisted in filling out the notification by the inspector? Y N N/A
- 2. Did the facility insist on filling out its own notification, and will send it to FDEP? Y N N/A

Record keeping :

- 1. Does facility have statement/specs as to the design accuracy of the temperature sensor? Y N N/A
(temperature of 45°F w/accuracy ±2°F, or 7.2°C w/accuracy of ±1.1°C)

Hazardous Waste:

- 1. Is all perc. contaminated wastewater either treated or disposed of properly? Y N
- 2. If wastewater is evaporated, is it an approved system, and using carbon filtration? Y N N/A
- 3. Does the facility have secondary containment for the dry-dry machine? Y N
- 4. Does the facility have secondary containment for any perc. waste containers? Y N

Comments:

AIRS ID#: 1030308

1400

Revised 10/10/9

DRY CLEANER AIR QUALITY GENERAL PERMIT ANNUAL COMPLIANCE CERTIFICATION FORM

FACILITY NAME: Carriage Cleaners DATE: 12/9/98
 FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL 33772

Annual Reporting Period: February 4, 1998 TO December 9, 1998

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____
 Action(s) taken to achieve compliance: _____
 Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____
 Action(s) taken to achieve compliance: _____
 Method used to demonstrate compliance: _____

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon rolling averages of purchase receipts, does not exceed 2,100 gallons per year for dry-to-dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: CLARK GAMBLE [Signature] 12/9/98
 Name (Please Print) Signature Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

✓
A

**TITLE V AIR QUALITY AIR GENERAL PERMIT
INSPECTION SUMMARY REPORT**

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

TIME IN: 10:20a.m.	TIME OUT: 10:30a.m.	AIRS ID# 1030308 001
TYPE OF FACILITY: Perchloroethylene Dry Cleaner		
FACILITY NAME: Carriage Cleaners	DATE: April 10, 1997	
FACILITY LOCATION : 5675 Seminole Blvd., Seminole, FL 34642		
RESPONSIBLE OFFICIAL: Mr. Clark Gamble	PHONE NUMBER: 813-392-2175	

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance discrepancies were noted:

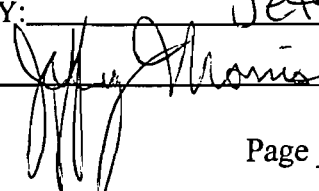
COMMENTS:

Facility utilizes its operations manual as its start-up, shutdown for malfunction plan. In addition, a one page letter is included.

The Annual Compliance Certification form has been properly certified and submitted to the inspector. Yes No

DATE OF NEXT INSPECTION: June 1, 1997 (Approximate)

INSPECTION CONDUCTED BY: Jeff Morris (Please Print)

INSPECTOR'S SIGNATURE:  PHONE NUMBER: 464-4422

**TITLE V AIR QUALITY AIR GENERAL PERMIT
INSPECTION SUMMARY REPORT**

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

AIRS ID#: 1030308 001 DATE: 12/9/98 TIME IN: 10:40am TIME OUT: 11:33am

FACILITY NAME: Carriage Cleaners

FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL, 33772

RESPONSIBLE OFFICIAL: Clark Gamble Phone No.: 392-2175

Permit No. 1030308-001-AG Exp. Date: 09/10/2001

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance **discrepancies** were noted (only items which are checked):

Inspection Summary Report Guidance

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not have a start-up, shutdown, malfunction (SSM) plan in place, along with associated recordkeeping, on site.	If no specific procedures are available from the manufacturer, develop a SSM plan that describes procedures for maintaining and operating equipment during periods of start-up and shutdown associated with a malfunction. EPA's O&M manual may be used if no manufacturers information is available. Keep log of maintenance actions
<input type="checkbox"/>	Purchase receipts were not maintained properly.	Maintain all purchase receipts in a log kept on-site for determination of perchloroethylene solvent consumption.
<input type="checkbox"/>	Monthly purchase records were not maintained as a consecutive twelve month total.	Develop and implement a recordkeeping procedure that maintains monthly purchases (perc) as a consecutive twelve month total.
<input type="checkbox"/>	Could not confirm that temperature sensor was designed to measure 45°F with an accuracy of ±2°F.	Obtain verification from the manufacturer that the temperature sensor is designed to measure 45°F with an accuracy of ±2°F, or determine this by another method that the Department would consider appropriate.
<input type="checkbox"/>	Evaporator for separator wastewater does not incorporate a pre-filtration system.	Facility may choose to either dispose of perc-containing separator water as hazardous waste, or incorporate a carbon filtration system with the evaporator (as per the State's guidelines).
<input type="checkbox"/>	Did not store all perc, and perc-containing waste in tightly sealed containers.	Store all perc and perc-containing waste in tightly sealed containers which are impervious and chemically unreactive to the solvent.
<input type="checkbox"/>	Did not maintain a log of leak detection inspection and repair records.	Develop and implement a leak detection inspection and repair program. Maintain a log of leak detection inspection and repair records.

**PERCHLOROETHYLENE DRY CLEANERS
TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST**

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY
RE-INSPECTION

AIRS ID#: 1030308 001 DATE: 12/9/98 TIME IN: 10:40am TIME OUT: 11:33am

FACILITY NAME: Carriage Cleaners

FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL, 33772

RESPONSIBLE OFFICIAL: Clark Gamble PHONE: 392-2175

CONTACT: Clark Gamble PHONE: 392-2175

PART I: NOTIFICATION

(Check appropriate box)

- 1. Existing facility notified DARM By 9/1/96
- 2. New facility notified DARM 30 days prior to startup
- 3. Facility failed to notify DARM to use general permit

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(Check appropriate box)

- No notification form
- Drop store / out of business / petroleum

- A.
- | | |
|---|--|
| <p>1. Existing small area source <input type="checkbox"/>
dry-to-dry only, $x < 140$ gal/yr
transfer only, $x < 200$ gal/yr
both types, $x < 140$ gal/yr
(Constructed before 12/9/91)</p> | <p>2. New small area source <input type="checkbox"/>
dry-to-dry only, $x < 140$ gal/yr
transfer only, $x < 200$ gal/yr
both types, $x < 140$ gal/yr
(Constructed on or after 12/9/91)</p> |
| <p>3. Existing large area source <input checked="" type="checkbox"/>
dry-to-dry only, $140 < x < 2,100$ gal/yr
transfer only, $200 < x < 1,800$ gal/yr
both types, $140 < x < 1,800$ gal/yr
(Constructed before 12/9/91)</p> | <p>4. New large area source <input type="checkbox"/>
dry-to-dry only, $140 < x < 2,100$ gal/yr
transfer only, $200 < x < 1,800$ gal/yr
both types, $140 < x < 1,800$ gal/yr
(Constructed on or after 12/9/91)</p> |

This is a correct facility classification: Y N Can not determine

If no, please check the appropriate classification:

- facility qualified for a general permit as number _____ above
- facility exceeds above limits and is not eligible for a general permit


B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 212 gallons.

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not conduct weekly leak detection and repair inspection.	Develop and implement a leak detection inspection and repair program. Use at least one of the methods outlined in Part II, Section 7(a), of the general permit provisions, to detect leaks. Inspect the items listed in Part II, Section 7(b), for leaks. Repair leaks within 24 hours of detection, unless repair equipment must be ordered.
<input type="checkbox"/>	No calibration records for the mechanical direct reading instrumentation (halogen detector) were available.	Mechanical direct-reading instrumentation shall be operated as directed by the manufacturer and must meet the conditions in Part II, Section 7(e) of the general permit provisions..
<input type="checkbox"/>	Did not measure and record the outlet temperature of the refrigerated condenser on the dry-to-dry machine (dryer, reclaimer) on a weekly basis.	Develop and implement a monitoring program. Measure and record the outlet temperature on a weekly basis. The temperature, measured at the end of the drying cycle, must not exceed 45°F.
<input type="checkbox"/>	Airflow is directed towards the refrigerated condenser upon the door being opened and no diverter valve is in place.	Equip the condenser with a diverter valve to prevent air flow to the refrigerated condenser when the door is opened.
<input type="checkbox"/>	The outlet exhaust temperature of the refrigerated condenser exceeds 45°F and was not repaired within 24 hours.	Repair or adjust condenser within 24 hours of measurement indicating that the outlet exhaust temperature of the refrigerated condenser exceeds 45°F. The repair shall be documented in the monitoring record log.
<input type="checkbox"/>	Machine doors are not closed and secure during times other than loading and unloading.	Keep doors closed and secured at all times except during loading and unloading.
<input type="checkbox"/>	Temperature monitoring was not conducted after an appropriate cooldown period and after verifying that the coolant was completely charged.	Conduct all temperature monitoring following an appropriate cooldown period and after verifying that the coolant has been completely charged.
<input type="checkbox"/>	Containers for perchloroethylene and/or perchloroethylene-containing waste were found to be leaking.	Examine the containers, used for storing perchloroethylene and/or perchloroethylene-containing waste, for leakage.
<input type="checkbox"/>		
<input type="checkbox"/>		

Comments: _____

If the Inspection Summary Report indicates follow-up actions are required, you must take immediate corrective measures to achieve compliance. Pinellas County will perform a follow-up inspection to determine that proper corrective actions have been taken.

Inspection Conducted by: Jeffrey Morris

Inspector's Signature: 

Phone Number: 464-4422

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

- | | | | |
|--|---------------------------------------|----------------------------|--|
| 1. Storing perchloroethylene in tightly sealed and impervious containers? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 2. Examining the containers for leakage? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 3. Closing and securing machine doors except during loading/unloading? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 5. Maintaining solvent-to- carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? | <input type="checkbox"/> Y | <input type="checkbox"/> N | <input checked="" type="checkbox"/> NA |

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification (1) has been checked, no controls are required. Proceed to Part V.

If classification (2) has been checked, the machine should be equipped with a refrigerated condenser (complete A below)

If classification (3) has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). Carbon adsorber must have been installed prior to September 22, 1993.

If classification (4) has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below.)

A. Has the responsible official of all new sources and existing large area sources: (check appropriate boxes)

- | | | | |
|--|---------------------------------------|----------------------------|-----------------------------|
| 1. Equipped all machines with the appropriate vent controls? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 2. Equipped dry-to-dry machines with a closed-loop vapor venting system? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a <u>weekly</u> /bi-weekly basis? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45° F? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 6. Conducted all temperature monitoring after an appropriate cool down period and after verifying the coolant had been completely charged? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |

B. Has the responsible official of an existing large or new large area source also:

- | | | |
|--|---------------------------------------|--|
| 1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N |
| 2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| Is the temperature differential equal to or greater than 20°F? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| 3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| Is the perc concentration equal to or less than 100 ppm? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| 4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc. concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend contraction, or expansion; and downstream from no other inlet? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| 5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| 6. Routed airflow to the carbon adsorber (if used) at all times? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

- | | | |
|--|---------------------------------------|---|
| 1. Maintained receipts for perc purchased? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N |
| 2. Maintained rolling monthly averages of perc consumption? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N |
| 3. Maintained leak detection inspection and repair reports for the following: | | |
| a. documentation of leaks repaired w/in 24 hrs? or; (vacuum seal replaced) on still 10/15/98 | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| 4. Maintained calibration data? (for direct reading instrument only) | <input type="checkbox"/> Y | <input type="checkbox"/> N <input checked="" type="checkbox"/> NA |
| 5. Maintained exhaust duct monitoring data on perc concentrations? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input checked="" type="checkbox"/> NA |
| 6. Maintained startup/shutdown/malfunction plan? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N |
| 7. Maintained deviation reports? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input checked="" type="checkbox"/> NA |
| Problem corrected? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input checked="" type="checkbox"/> NA |
| 8. Maintained compliance plan, if applicable? | <input type="checkbox"/> Y | <input type="checkbox"/> N <input checked="" type="checkbox"/> NA |

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly (for small sources, bi-weekly) leak detection and repair inspection? Y N

2. Has the facility maintained a leak log? Y N

3. Does the responsible official check the following areas for leaks:

- | | | | |
|---|--|--------------------------|--|
| Hose connections, fitting couplings, and valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Muck cookers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Door gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Stills | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Filter gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Exhaust dampers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Pumps | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Diverter valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Solvent tanks and containers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Cartridge Filter housing | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Water separators | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | | |

4. Which method of detection is used by the responsible official?
- Visual examination (condensed solvent of exterior surfaces)
 - Physical detection (airflow felt through gaskets)
 - Odor (noticeable perc odor)
 - Use of direct-reading instrumentation (FID/PID/calorimetric tubes)
 - Halogen leak detector

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm. Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only). Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use. Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

Jeff Morris
Inspector's Name (Please Print)

12/9/98
Date of Inspection

[Signature]
Inspector's Signature

6/9/98
Approximate Date of Next Inspection

FACILITY DETAILS:

FACILITY NAME: Carriage Cleaners

Dry Cleaning Machine #1:

Manufacturer Miraclean Capacity 35 lbs
Model# Type DERG3-0250 Serial# 89J541880 Mfg yr 1989

Dry Cleaning Machine #2:

Manufacturer _____ Capacity _____ lbs
Model# _____ Serial# _____ Mfg yr _____

Boiler:

Manufacturer Hurst Hp 150
Model # 4161 Serial # V56-150-21 Mfg yr 1991
Fuel Type: Natural gas? propane? fuel oil?

Notification (unpermitted sources only):

- 1. Was the facility assisted in filling out the notification by the inspector? Y N N/A
- 2. Did the facility insist on filling out its own notification, and will send it to FDEP? Y N N/A

Record keeping :

- 1. Does facility have statement/specs as to the design accuracy of the temperature sensor? Y N
(temperature of 45°F w/accuracy ±2°F, or 7.2°C w/accuracy of ±1.1°C)

Hazardous Waste:

- 1. Is all perc. contaminated wastewater either treated or disposed of properly? Y N
- 2. If wastewater is evaporated, is it an approved system, and using carbon filtration? Y N
- 3. Does the facility have secondary containment for the dry-dry machine? Y N
- 4. Does the facility have secondary containment for any perc. waste containers? Y N

Comments:

ADDITIONAL SITE INFORMATION:

Responsible Official correctly indentified all
leak check points.

AIRWD#: 1030308

ACC

Revised 10/10/9

DRY CLEANER AIR QUALITY GENERAL PERMIT ANNUAL COMPLIANCE CERTIFICATION FORM

FACILITY NAME: Carriage Cleaners DATE: 6/4/99
 FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL 34642

Annual Reporting Period: December 9, 1998 TO June 4, 1999

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____

Action(s) taken to achieve compliance: _____

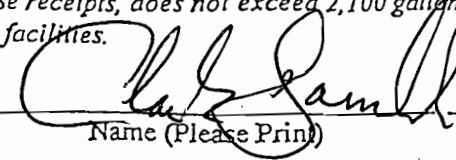
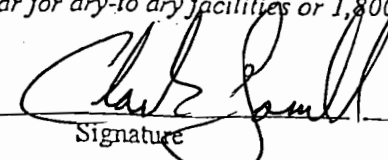
Method used to demonstrate compliance: _____

RECEIVED

JUL 12 1999

Bureau of Air Monitoring
& Mobile Sources

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon rolling averages of purchase receipts, does not exceed 2,100 gallons per year for dry-to dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL:   6/4/99
 Name (Please Print) Signature Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

**TITLE V AIR QUALITY AIR GENERAL PERMIT
INSPECTION SUMMARY REPORT**

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

AIRS ID#: <u>1030308 001</u>	DATE: <u>6/2/99</u>	TIME IN: <u>11:23 a.m.</u>	TIME OUT: <u>12:05 p.m.</u>
FACILITY NAME: <u>Carriage Cleaners</u>			
FACILITY LOCATION: <u>5675 Seminole Blvd.</u>			
<u>Seminole, FL, 33772</u>			
RESPONSIBLE OFFICIAL: <u>Clark Gamble</u>		Phone No.: <u>392-2175</u>	
Permit No. <u>1030308-001-AG</u>		Exp. Date: <u>09/10/2001</u>	

RECEIVED

JUL 12 1999

Bureau of Air Monitoring
& Mobile Sources

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance **discrepancies** were noted (only items which are checked):

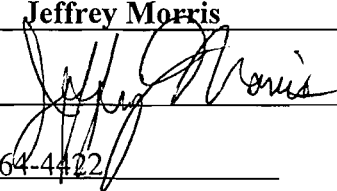
Inspection Summary Report Guidance

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not have a start-up, shutdown, malfunction (SSM) plan in place, along with associated recordkeeping, on site.	If no specific procedures are available from the manufacturer, develop a SSM plan that describes procedures for maintaining and operating equipment during periods of start-up and shutdown associated with a malfunction. EPA's O&M manual may be used if no manufacturers information is available. Keep log of maintenance actions
<input type="checkbox"/>	Purchase receipts were not maintained properly.	Maintain all purchase receipts in a log kept on-site for determination of perchloroethylene solvent consumption.
<input type="checkbox"/>	Monthly purchase records were not maintained as a consecutive twelve month total.	Develop and implement a recordkeeping procedure that maintains monthly purchases (perc) as a consecutive twelve month total.
<input type="checkbox"/>	Could not confirm that temperature sensor was designed to measure 45°F with an accuracy of ±2°F.	Obtain verification from the manufacturer that the temperature sensor is designed to measure 45°F with an accuracy of ±2°F, or determine this by another method that the Department would consider appropriate.
<input type="checkbox"/>	Evaporator for separator wastewater does not incorporate a pre-filtration system.	Facility may choose to either dispose of perc-containing separator water as hazardous waste, or incorporate a carbon filtration system with the evaporator (as per the State's guidelines).
<input type="checkbox"/>	Did not store all perc, and perc-containing waste in tightly sealed containers.	Store all perc and perc-containing waste in tightly sealed containers which are impervious and chemically unreactive to the solvent.
<input type="checkbox"/>	Did not maintain a log of leak detection inspection and repair records.	Develop and implement a leak detection inspection and repair program. Maintain a log of leak detection inspection and repair records.

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not conduct weekly leak detection and repair inspection.	Develop and implement a leak detection inspection and repair program. Use at least one of the methods outlined in Part II, Section 7(a), of the general permit provisions, to detect leaks. Inspect the items listed in Part II, Section 7(b), for leaks. Repair leaks within 24 hours of detection, unless repair equipment must be ordered.
<input type="checkbox"/>	No calibration records for the mechanical direct reading instrumentation (halogen detector) were available.	Mechanical direct-reading instrumentation shall be operated as directed by the manufacturer and must meet the conditions in Part II, Section 7(e) of the general permit provisions..
<input type="checkbox"/>	Did not measure and record the outlet temperature of the refrigerated condenser on the dry-to-dry machine (dryer, reclaimmer) on a weekly basis.	Develop and implement a monitoring program. Measure and record the outlet temperature on a weekly basis. The temperature, measured at the end of the drying cycle, must not exceed 45°F.
<input type="checkbox"/>	Airflow is directed towards the refrigerated condenser upon the door being opened and no diverter valve is in place.	Equip the condenser with a diverter valve to prevent air flow to the refrigerated condenser when the door is opened.
<input type="checkbox"/>	The outlet exhaust temperature of the refrigerated condenser exceeds 45°F and was not repaired within 24 hours.	Repair or adjust condenser within 24 hours of measurement indicating that the outlet exhaust temperature of the refrigerated condenser exceeds 45°F. The repair shall be documented in the monitoring record log.
<input type="checkbox"/>	Machine doors are not closed and secure during times other than loading and unloading.	Keep doors closed and secured at all times except during loading and unloading.
<input type="checkbox"/>	Temperature monitoring was not conducted after an appropriate cooldown period and after verifying that the coolant was completely charged.	Conduct all temperature monitoring following an appropriate cooldown period and after verifying that the coolant has been completely charged.
<input type="checkbox"/>	Containers for perchloroethylene and/or perchloroethylen-containing waste were found to be leaking.	Examine the containers, used for storing perchloroethylene and/or perchloroethylene-containing waste, for leakage.
<input type="checkbox"/>		
<input type="checkbox"/>		

Comments: _____

If the Inspection Summary Report indicates follow-up actions are required, you must take immediate corrective measures to achieve compliance. Pinellas County will perform a follow-up inspection to determine that proper corrective actions have been taken.

Inspection Conducted by: Jeffrey Morris
 Inspector's Signature: 
 Phone Number: 464-4422

**PERCHLOROETHYLENE DRY CLEANERS
TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST**

TYPE OF INSPECTION: ANNUAL RE-INSPECTION COMPLAINT/DISCOVERY

AIRS ID#: <u>1030308 001</u>	DATE: <u>6/2/99</u>	TIME IN: <u>11:23 a.m.</u>	TIME OUT: <u>12:05 p.m.</u>
FACILITY NAME: <u>Carriage Cleaners</u>			
FACILITY LOCATION: <u>5675 Seminole Blvd.</u>			
		<u>Seminole, FL, 33772</u>	
RESPONSIBLE OFFICIAL: <u>Clark Gamble</u>		PHONE: <u>813-217-1187</u>	
CONTACT: _____		PHONE: _____	

RECEIVED

JUL 12 1999

Bureau of Air Monitoring
& Mobile Sources

PART I: NOTIFICATION

(Check appropriate box)

1. Existing facility notified DARM By 9/1/96	<input checked="" type="checkbox"/>
2. New facility notified DARM 30 days prior to startup	<input type="checkbox"/>
3. Facility failed to notify DARM to use general permit	<input type="checkbox"/>

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(Check appropriate box)

<p>A.</p> <p>1. Existing small area source <input type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed before 12/9/91)</p> <p>3. Existing large area source <input checked="" type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed before 12/9/91)</p>	<p><input type="checkbox"/> No notification form</p> <p><input type="checkbox"/> Drop store / out of business / petroleum</p> <p>2. New small area source <input type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed on or after 12/9/91)</p> <p>4. New large area source <input type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed on or after 12/9/91)</p>
---	--

This is a correct facility classification: Y N Can not determine

If no, please check the appropriate classification:

facility qualified for a general permit as number _____ above

facility exceeds above limits and is not eligible for a general permit

B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 178 gallons.

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

1. Storing perchloroethylene in tightly sealed and impervious containers? Y N NA
2. Examining the containers for leakage? Y N NA
3. Closing and securing machine doors except during loading/unloading? Y N
4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? Y N NA
5. Maintaining solvent-to- carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? Y N NA

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification (1) has been checked, no controls are required. Proceed to Part V.

If classification (2) has been checked, the machine should be equipped with a refrigerated condenser (complete A below)

If classification (3) has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). Carbon adsorber must have been installed prior to September 22, 1993.

If classification (4) has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below.)

A. Has the responsible official of all new sources and existing large area sources: (check appropriate boxes)

1. Equipped all machines with the appropriate vent controls? Y N
2. Equipped dry-to-dry machines with a closed-loop vapor venting system? Y N NA
3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? Y N NA
4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a weekly bi-weekly basis? Y N
5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45°F? Y N NA
6. Conducted all temperature monitoring after an appropriate cool down period and after verifying the coolant had been completely charged? Y N

B. Has the responsible official of an existing large or new large area source also:

1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? Y N
2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly? Y N NA
Is the temperature differential equal to or greater than 20° F? Y N NA
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber? Y N NA
Is the perc concentration equal to or less than 100 ppm? Y N NA
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc. concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend contraction, or expansion; and downstream from no other inlet? Y N NA
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils? Y N NA
6. Routed airflow to the carbon adsorber (if used) at all times? Y N NA

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased? Y N
2. Maintained rolling monthly averages of perc consumption? Y N
3. Maintained leak detection inspection and repair reports for the following:
- a. documentation of leaks repaired w/in 24 hrs? or; Y N NA
 - b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt? Y N NA
4. Maintained calibration data? (for direct reading instrument only) Y N NA
5. Maintained exhaust duct monitoring data on perc concentrations? Y N NA
6. Maintained startup/shutdown/malfunction plan? Y N
7. Maintained deviation reports? Y N NA
Problem corrected? Y N NA
8. Maintained compliance plan, if applicable? Y N NA

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly (for small sources, bi-weekly) leak detection and repair inspection? Y N

2. Has the facility maintained a leak log? Y N

3. Does the responsible official check the following areas for leaks:

- | | | | |
|---|--|--------------------------|--|
| Hose connections, fitting couplings, and valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Muck cookers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Door gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Stills | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Filter gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Exhaust dampers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Pumps | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Diverter valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Solvent tanks and containers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Cartridge Filter housing | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Water separators | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | | |

4. Which method of detection is used by the responsible official?

- Visual examination (condensed solvent of exterior surfaces)
- Physical detection (airflow felt through gaskets)
- Odor (noticeable perc odor)
- Use of direct-reading instrumentation (FID/PID/calorimetric tubes)
- Halogen leak detector

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm. Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only). Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use. Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

Jeff Morris
Inspector's Name (Please Print)

6/2/99
Date of Inspection

Jeff Morris
Inspector's Signature

12/16/99
Approximate Date of Next Inspection

ADDITIONAL SITE INFORMATION:

Refrigerated outlet exhaust temperature during cool down cycle was 40.5°F. *ym*

DRY CLEANER AIR QUALITY GENERAL PERMIT
ANNUAL COMPLIANCE CERTIFICATION FORM

FACILITY NAME: Carriage Cleaners DATE: 12/29/99
 FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL 33772

Annual Reporting Period: June 2, 1999 TO December 29, 1999

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

RECEIVED
JAN 18 2000
Bureau of Air Monitoring
& Mobile Sources

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon rolling averages of purchase receipts, does not exceed 2,100 gallons per year for dry-to dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: CLARK GAMBLE Clark Gamble 12/29/99
 Name (Please Print) Signature Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

✓

**PERCHLOROETHYLENE DRY CLEANERS
TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST**

TYPE OF INSPECTION: ANNUAL RE-INSPECTION COMPLAINT/DISCOVERY

AIRS ID#: 1030308 DATE: 12/29/99 TIME IN: 8:43am TIME OUT: 10:15am

FACILITY NAME: Carriage Cleaners

FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL 33772

RESPONSIBLE OFFICIAL: Clark Gamble PHONE: 392-2175

CONTACT: Clark Gable PHONE: 392-2175

PART I: NOTIFICATION

(Check appropriate box)

- 1. Existing facility notified DARM By 9/1/96
- 2. New facility notified DARM 30 days prior to startup
- 3. Facility failed to notify DARM to use general permit

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(Check appropriate box)

- | | |
|--|---|
| <p>A.</p> <ul style="list-style-type: none"> 1. Existing small area source <input type="checkbox"/>
dry-to-dry only, $x < 140$ gal/yr
transfer only, $x < 200$ gal/yr
both types, $x < 140$ gal/yr
(Constructed before 12/9/91) 3. Existing large area source <input checked="" type="checkbox"/>
dry-to-dry only, $140 < x < 2,100$ gal/yr
transfer only, $200 < x < 1,800$ gal/yr
both types, $140 < x < 1,800$ gal/yr
(Constructed before 12/9/91) | <ul style="list-style-type: none"> <input type="checkbox"/> No notification form <input type="checkbox"/> Drop store / out of business / petroleum 2. New small area source <input type="checkbox"/>
dry-to-dry only, $x < 140$ gal/yr
transfer only, $x < 200$ gal/yr
both types, $x < 140$ gal/yr
(Constructed on or after 12/9/91) 4. New large area source <input type="checkbox"/>
dry-to-dry only, $140 < x < 2,100$ gal/yr
transfer only, $200 < x < 1,800$ gal/yr
both types, $140 < x < 1,800$ gal/yr
(Constructed on or after 12/9/91) |
|--|---|

This is a correct facility classification: Y N Can not determine

If no, please check the appropriate classification:

- facility qualified for a general permit as number _____ above
- facility exceeds above limits and is not eligible for a general permit

B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 136 gallons.

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

- | | | | |
|--|---------------------------------------|----------------------------|--|
| 1. Storing perchloroethylene in tightly sealed and impervious containers? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 2. Examining the containers for leakage? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 3. Closing and securing machine doors except during loading/unloading? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 5. Maintaining solvent-to- carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? | <input type="checkbox"/> Y | <input type="checkbox"/> N | <input checked="" type="checkbox"/> NA |

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification (1) has been checked, no controls are required. Proceed to Part V.

If classification (2) has been checked, the machine should be equipped with a refrigerated condenser (complete A below)

If classification (3) has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). Carbon adsorber must have been installed prior to September 22, 1993.

If classification (4) has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below.)

A. Has the responsible official of all new sources and existing large area sources: (check appropriate boxes)

- | | | | |
|--|---------------------------------------|---------------------------------------|--|
| 1. Equipped all machines with the appropriate vent controls? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 2. Equipped dry-to-dry machines with a closed-loop vapor venting system? | | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N <input type="checkbox"/> NA |
| 3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a <u>weekly</u> bi-weekly basis? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45°F? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 6. Conducted all temperature monitoring after an appropriate cool down period and after verifying the coolant had been completely charged? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |

B. Has the responsible official of an existing large or new large area source also:

1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? Y N
2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly? Y N NA
Is the temperature differential equal to or greater than 20° F? Y N NA
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber? Y N NA
Is the perc concentration equal to or less than 100 ppm? Y N NA
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc. concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend contraction, or expansion; and downstream from no other inlet? Y N NA
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils? Y N NA
6. Routed airflow to the carbon adsorber (if used) at all times? Y N NA

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased? Y N
2. Maintained rolling monthly averages of perc consumption? Y N
3. Maintained leak detection inspection and repair reports for the following:
- a. documentation of leaks repaired w/in 24 hrs? or; Y N NA
 - b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt? Y N NA
4. Maintained calibration data? (for direct reading instrument only) Y N NA
5. Maintained exhaust duct monitoring data on perc concentrations? Y N NA
6. Maintained startup/shutdown/malfunction plan? Y N
7. Maintained deviation reports? Y N NA
Problem corrected? Y N NA
8. Maintained compliance plan, if applicable? Y N NA

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly (for small sources, bi-weekly) leak detection and repair inspection? Y N

2. Has the facility maintained a leak log? Y N

3. Does the responsible official check the following areas for leaks:

- | | | | |
|---|--|--------------------------|--|
| Hose connections, fitting couplings, and valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Muck cookers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Door gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Stills | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Filter gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Exhaust dampers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Pumps | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Diverter valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Solvent tanks and containers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Cartridge Filter housing | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Water separators | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | | |

4. Which method of detection is used by the responsible official?

- Visual examination (condensed solvent of exterior surfaces)
- Physical detection (airflow felt through gaskets)
- Odor (noticeable perc odor)
- Use of direct-reading instrumentation (FID/PID/calorimetric tubes)
- Halogen leak detector

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm. Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only): Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use. Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

Jeff Morris
Inspector's Name (Please Print)

[Signature]
Inspector's Signature

12/29/99
Date of Inspection

6/29/99
Approximate Date of Next Inspection

ACC

DRY CLEANER AIR QUALITY GENERAL PERMIT
ANNUAL COMPLIANCE CERTIFICATION FORM

FACILITY NAME: Carriage Cleaners DATE: 6/7/00
 FACILITY LOCATION: 5675 Seminole Blvd.
Seminole, FL 33772

RECEIVED
 JUL 1 - 2000
 Bureau of Air Monitoring
 & Mobile Studies
 June 7, 2000

Annual Reporting Period: December 29, 1999 TO _____

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. YES NO

If NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____
 Action(s) taken to achieve compliance: _____
 Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: from _____ to _____
 Action(s) taken to achieve compliance: _____
 Method used to demonstrate compliance: _____

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon rolling averages of purchase receipts, does not exceed 2,100 gallons per year for dry-to-dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: CLARK GAMBLE Clark Gamble 6/7/00
 Name (Please Print) Signature Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

✓
**TITLE V AIR QUALITY AIR GENERAL PERMIT
 INSPECTION SUMMARY REPORT**

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

AIRS ID#: <u>1030308</u>	DATE: <u>6/7/00</u>	TIME IN: <u>10:07 a.m.</u>	TIME OUT: <u>12:10 p.m.</u>
FACILITY NAME: <u>Carriage Cleaners</u>			
FACILITY LOCATION: <u>5675 Seminole Boulevard</u>			
<u>Seminole, FL 33772</u>			
RESPONSIBLE OFFICIAL: <u>Clark Gamble</u>		Phone No.: <u>392-2175</u>	
Permit No. <u>1030308</u>	Exp. Date: <u>8/17/2001</u>		

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance discrepancies were noted (only items which are checked):

Inspection Summary Report Guidance

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not have a start-up, shutdown, malfunction (SSM) plan in place, along with associated recordkeeping, on site.	If no specific procedures are available from the manufacturer, develop a SSM plan that describes procedures for maintaining and operating equipment during periods of start-up and shutdown associated with a malfunction. EPA's O&M manual may be used if no manufacturers information is available. Keep log of maintenance actions
<input type="checkbox"/>	Purchase receipts were not maintained properly.	Maintain all purchase receipts in a log kept on-site for determination of perchloroethylene solvent consumption.
<input type="checkbox"/>	Monthly purchase records were not maintained as a consecutive twelve month total.	Develop and implement a recordkeeping procedure that maintains monthly purchases (perc) as a consecutive twelve month total.
<input type="checkbox"/>	Could not confirm that temperature sensor was designed to measure 45°F with an accuracy of ±2°F.	Obtain verification from the manufacturer that the temperature sensor is designed to measure 45°F with an accuracy of ±2°F, or determine this by another method that the Department would consider appropriate.
<input type="checkbox"/>	Evaporator for separator wastewater does not incorporate a pre-filtration system.	Facility may choose to either dispose of perc-containing separator water as hazardous waste, or incorporate a carbon filtration system with the evaporator (as per the State's guidelines).
<input type="checkbox"/>	Did not store all perc, and perc-containing waste in tightly sealed containers.	Store all perc and perc-containing waste in tightly sealed containers which are impervious and chemically unreactive to the solvent.
<input type="checkbox"/>	Did not maintain a log of leak detection inspection and repair records.	Develop and implement a leak detection inspection and repair program. Maintain a log of leak detection inspection and repair records.

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not conduct weekly leak detection and repair inspection.	Develop and implement a leak detection inspection and repair program. Use at least one of the methods outlined in Part II, Section 7(a), of the general permit provisions, to detect leaks. Inspect the items listed in Part II, Section 7(b), for leaks. Repair leaks within 24 hours of detection, unless repair equipment must be ordered.
<input type="checkbox"/>	No calibration records for the mechanical direct reading instrumentation (halogen detector) were available.	Mechanical direct-reading instrumentation shall be operated as directed by the manufacturer and must meet the conditions in Part II, Section 7(e) of the general permit provisions..
<input type="checkbox"/>	Did not measure and record the outlet temperature of the refrigerated condenser on the dry-to-dry machine (dryer, reclaimer) on a weekly basis.	Develop and implement a monitoring program. Measure and record the outlet temperature on a weekly basis. The temperature, measured at the end of the drying cycle, must not exceed 45°F.
<input type="checkbox"/>	Airflow is directed towards the refrigerated condenser upon the door being opened and no diverter valve is in place.	Equip the condenser with a diverter valve to prevent air flow to the refrigerated condenser when the door is opened.
<input type="checkbox"/>	The outlet exhaust temperature of the refrigerated condenser exceeds 45°F and was not repaired within 24 hours.	Repair or adjust condenser within 24 hours of measurement indicating that the outlet exhaust temperature of the refrigerated condenser exceeds 45°F. The repair shall be documented in the monitoring record log.
<input type="checkbox"/>	Machine doors are not closed and secure during times other than loading and unloading.	Keep doors closed and secured at all times except during loading and unloading.
<input type="checkbox"/>	Temperature monitoring was not conducted after an appropriate cooldown period and after verifying that the coolant was completely charged.	Conduct all temperature monitoring following an appropriate cooldown period and after verifying that the coolant has been completely charged.
<input type="checkbox"/>	Containers for perchloroethylene and/or perchloroethylen-containing waste were found to be leaking.	Examine the containers, used for storing perchloroethylene and/or perchloroethylene-containing waste, for leakage.
<input type="checkbox"/>		
<input type="checkbox"/>		

Comments: _____

If the Inspection Summary Report indicates follow-up actions are required, you must take immediate corrective measures to achieve compliance. Pinellas County will perform a follow-up inspection to determine that proper corrective actions have been taken.

Inspection Conducted by: _____ *Jeff Morris*

Inspector's Signature: _____ *[Signature]*

Phone Number: _____ *464-4422*

**PERCHLOROETHYLENE DRY CLEANERS
TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST**

✓ **TYPE OF INSPECTION:** ANNUAL RE-INSPECTION COMPLAINT/DISCOVERY

AIRS ID#: <u>1030308</u>	Date: <u>6/7/00</u>	TIME IN: <u>11:07a.m</u>	TIME OUT: <u>12:10 p.m</u>
FACILITY NAME: <u>Carriage Cleaners</u>			
FACILITY LOCATION: <u>5675 Seminole Boulevard</u> <u>Seminole, FL, 33772</u>			
RESPONSIBLE OFFICIAL: <u>Clark Gamble</u>		PHONE: <u>392-2175</u>	
CONTACT: <u>Clark Gamble</u>		PHONE: <u>392-2175</u>	

PART I: NOTIFICATION	
(Check appropriate box)	
1. Existing facility notified DARM By 9/1/96	<input checked="" type="checkbox"/>
2. New facility notified DARM 30 days prior to startup	<input type="checkbox"/>
3. Facility failed to notify DARM to use general permit	<input checked="" type="checkbox"/>

PART II: CLASSIFICATION	
Facility indicated on notification form that it is: (Check appropriate box)	<input type="checkbox"/> No notification form <input type="checkbox"/> Drop store / out of business / petroleum
A.	
1. Existing small area source <input type="checkbox"/> dry-to-dry only, x<140 gal/yr transfer only, x<200 gal/yr both types, x<140 gal/yr (Constructed before 12/9/91)	2. New small area source <input type="checkbox"/> dry-to-dry only, x<140 gal/yr transfer only, x<200 gal/yr both types, x<140 gal/yr (Constructed on or after 12/9/91)
3. Existing large area source <input checked="" type="checkbox"/> dry-to-dry only, 140<x<2,100 gal/yr transfer only, 200<x<1,800 gal/yr both types, 140<x<1,800 gal/yr (Constructed before 12/9/91)	4. New large area source <input type="checkbox"/> dry-to-dry only, 140<x<2,100 gal/yr transfer only, 200<x<1,800 gal/yr both types, 140<x<1,800 gal/yr (Constructed on or after 12/9/91)
This is a correct facility classification: <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> Can not determine	
If no, please check the appropriate classification:	
<input type="checkbox"/> facility qualified for a general permit as number _____ above	
<input type="checkbox"/> facility exceeds above limits and is not eligible for a general permit	
B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was <u>24</u> gallons.	

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

1. Storing perchloroethylene in tightly sealed and impervious containers? Y N NA
2. Examining the containers for leakage? Y N NA
3. Closing and securing machine doors except during loading/unloading? Y N
4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? Y N NA
5. Maintaining solvent-to- carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? Y N NA

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification (1) has been checked, no controls are required. Proceed to Part V.

If classification (2) has been checked, the machine should be equipped with a refrigerated condenser (complete A below)

If classification (3) has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). Carbon adsorber must have been installed prior to September 22, 1993.

If classification (4) has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below.)

A. Has the responsible official of all new sources and existing large area sources: (check appropriate boxes)

1. Equipped all machines with the appropriate vent controls? Y N
2. Equipped dry-to-dry machines with a closed-loop vapor venting system? Y N NA
3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? Y N NA
4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a weekly/bi-weekly basis? Y N
5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45° F? Y N NA
6. Conducted all temperature monitoring after an appropriate cool down period and after verifying the coolant had been completely charged? Y N

B. Has the responsible official of an existing large or new large area source also:

1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? Y N
2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly? Y N NA
 Is the temperature differential equal to or greater than 20° F? Y N NA
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber? Y N NA
 Is the perc concentration equal to or less than 100 ppm? Y N NA
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc. concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend contraction, or expansion; and downstream from no other inlet? Y N NA
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils? Y N NA
6. Routed airflow to the carbon adsorber (if used) at all times? Y N NA

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased? Y N
2. Maintained rolling monthly averages of perc consumption? Y N
3. Maintained leak detection inspection and repair reports for the following:
 - a. documentation of leaks repaired w/in 24 hrs? or; Y N NA
 - b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt? Y N NA
4. Maintained calibration data? (for direct reading instrument only) Y N NA
5. Maintained exhaust duct monitoring data on perc concentrations? Y N NA
6. Maintained startup/shutdown/malfunction plan? Y N
7. Maintained deviation reports? Y N NA
 Problem corrected? Y N NA
8. Maintained compliance plan, if applicable? Y N NA

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly (for small sources, bi-weekly) leak detection and repair inspection? Y N

2. Has the facility maintained a leak log? Y N

3. Does the responsible official check the following areas for leaks:

- | | | | |
|---|--|--------------------------|--|
| Hose connections, fitting couplings, and valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Muck cookers | <input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> NA |
| Door gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Stills | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Filter gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Exhaust dampers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Pumps | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Diverter valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Solvent tanks and containers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Cartridge Filter housing | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Water separators | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | | |

4. Which method of detection is used by the responsible official?

- Visual examination (condensed solvent of exterior surfaces)
- Physical detection (airflow felt through gaskets)
- Odor (noticeable perc odor)
- Use of direct-reading instrumentation (FID/PID/calorimetric tubes)
- Halogen leak detector

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm. Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only). Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use. Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

Jeff Morris
Inspector's Name (Please Print)

Jeff Morris
Inspector's Signature

6/7/00
Date of Inspection

12/7/00
Approximate Date of Next Inspection

PC

**DRY CLEANER AIR QUALITY GENERAL PERMIT
ANNUAL COMPLIANCE CERTIFICATION FORM**

FACILITY NAME: Carriage Cleaners **Date:** 12/15/00

FACILITY LOCATION: 5675 Seminole Boulevard
Seminole, FL, 33772

Annual Reporting Period: June 7, 2000 To December 15, 2000

Based on each term or condition of the Title V general air permit, my facility has remained in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.), during the period covered by this statement. **YES** **NO**

IF NO, complete the following:

#1. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: **from** _____ **to** _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

#2. Term or condition of the general permit that has not been in continuous compliance during the reporting period stated above:

Exact period of non-compliance: **from** _____ **to** _____

Action(s) taken to achieve compliance: _____

Method used to demonstrate compliance: _____

RECEIVED
JAN 11 2001
Bureau of Air Monitoring
& Mobile Sources

As the responsible official, I hereby certify, based on information and belief formed after reasonable inquiry, that the statements made in this notification are true, accurate and complete. Further, my annual consumption of perchloroethylene solvent, based upon rolling averages of purchase receipts, does not exceed 2,100 gallons per year for dry-to-dry facilities or 1,800 gallons per year for transfer or combination facilities.

RESPONSIBLE OFFICIAL: Clark Gamble *Clark Gamble* 12/15/00
(Name, Please Print) Signature Date

*This form is made available to you as an aid in order to meet your annual compliance certification requirements. It is at the discretion of the responsible official to use this form.

**TITLE V AIR QUALITY AIR GENERAL PERMIT
INSPECTION SUMMARY REPORT**

TYPE OF INSPECTION: ANNUAL COMPLAINT/DISCOVERY RE-INSPECTION

AIRS ID#: 1030308 DATE: 12/15/00 TIME IN: 11:35am TIME OUT: 11:45am
 FACILITY NAME: Carriage Cleaners
 FACILITY LOCATION: 5675 Seminole Boulevard
 Seminole, FL, 33772
 RESPONSIBLE OFFICIAL: Clark Gamble Phone No.: (727) 392-2175
 Permit No. 1030308-001-AG Exp. Date: 8/17/2001

- Based on the results of the compliance requirements evaluated during this inspection, the facility is found to be in compliance with DEP Rule 62-213.300, Florida Administrative Code (F.A.C.).
- Based on the results of the compliance requirements evaluated during this inspection, the following compliance **discrepancies** were noted (only items which are checked):

Inspection Summary Report Guidance

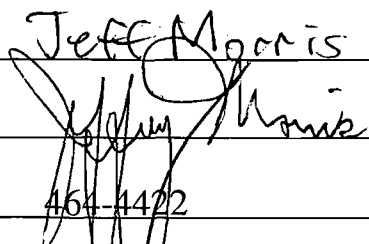
	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not have a start-up, shutdown, malfunction (SSM) plan in place, along with associated recordkeeping, on site.	If no specific procedures are available from the manufacturer, develop a SSM plan that describes procedures for maintaining and operating equipment during periods of start-up and shutdown associated with a malfunction. EPA's O&M manual may be used if no manufacturers information is available. Keep log of maintenance actions
<input type="checkbox"/>	Purchase receipts were not maintained properly.	Maintain all purchase receipts in a log kept on-site for determination of perchloroethylene solvent consumption.
<input type="checkbox"/>	Monthly purchase records were not maintained as a consecutive twelve month total.	Develop and implement a recordkeeping procedure that maintains monthly purchases (perc) as a consecutive twelve month total.
<input type="checkbox"/>	Could not confirm that temperature sensor was designed to measure 45°F with an accuracy of ±2°F.	Obtain verification from the manufacturer that the temperature sensor is designed to measure 45°F with an accuracy of ±2°F, or determine this by another method that the Department would consider appropriate.
<input type="checkbox"/>	Evaporator for separator wastewater does not incorporate a pre-filtration system.	Facility may choose to either dispose of perc-containing separator water as hazardous waste, or incorporate a carbon filtration system with the evaporator (as per the State's guidelines).
<input type="checkbox"/>	Did not store all perc, and perc-containing waste in tightly sealed containers.	Store all perc and perc-containing waste in tightly sealed containers which are impervious and chemically unreactive to the solvent.
<input type="checkbox"/>	Did not maintain a log of leak detection inspection and repair records.	Develop and implement a leak detection inspection and repair program. Maintain a log of leak detection inspection and repair records.

	Compliance Requirement/Problem	Follow-up Action Required
<input type="checkbox"/>	Did not conduct weekly leak detection and repair inspection.	Develop and implement a leak detection inspection and repair program. Use at least one of the methods outlined in Part II, Section 7(a), of the general permit provisions, to detect leaks. Inspect the items listed in Part II, Section 7(b), for leaks. Repair leaks within 24 hours of detection, unless repair equipment must be ordered.
<input type="checkbox"/>	No calibration records for the mechanical direct reading instrumentation (halogen detector) were available.	Mechanical direct-reading instrumentation shall be operated as directed by the manufacturer and must meet the conditions in Part II, Section 7(e) of the general permit provisions..
<input type="checkbox"/>	Did not measure and record the outlet temperature of the refrigerated condenser on the dry-to-dry machine (dryer, reclaimer) on a weekly basis.	Develop and implement a monitoring program. Measure and record the outlet temperature on a weekly basis. The temperature, measured at the end of the drying cycle, must not exceed 45°F.
<input type="checkbox"/>	Airflow is directed towards the refrigerated condenser upon the door being opened and no diverter valve is in place.	Equip the condenser with a diverter valve to prevent air flow to the refrigerated condenser when the door is opened.
<input type="checkbox"/>	The outlet exhaust temperature of the refrigerated condenser exceeds 45°F and was not repaired within 24 hours.	Repair or adjust condenser within 24 hours of measurement indicating that the outlet exhaust temperature of the refrigerated condenser exceeds 45°F. The repair shall be documented in the monitoring record log.
<input type="checkbox"/>	Machine doors are not closed and secure during times other than loading and unloading.	Keep doors closed and secured at all times except during loading and unloading.
<input type="checkbox"/>	Temperature monitoring was not conducted after an appropriate cooldown period and after verifying that the coolant was completely charged.	Conduct all temperature monitoring following an appropriate cooldown period and after verifying that the coolant has been completely charged.
<input type="checkbox"/>	Containers for perchloroethylene and/or perchloroethylen-containing waste were found to be leaking.	Examine the containers, used for storing perchloroethylene and/or perchloroethylene-containing waste, for leakage.
<input type="checkbox"/>		
<input type="checkbox"/>		

Comments: _____

If the Inspection Summary Report indicates follow-up actions are required, you must take immediate corrective measures to achieve compliance. Pinellas County will perform a follow-up inspection to determine that proper corrective actions have been taken.

Inspection Conducted by: Jeff Morris

Inspector's Signature: 

Phone Number: 464-4422

**PERCHLOROETHYLENE DRY CLEANERS
TITLE V GENERAL PERMIT
COMPLIANCE INSPECTION CHECKLIST**

TYPE OF INSPECTION: ANNUAL RE-INSPECTION COMPLAINT/DISCOVERY

AIRS ID#: <u>1030308</u>	Date: <u>12/15/00</u>	TIME IN: <u>11:35 a.m.</u>	TIME OUT: <u>11:45 a.m.</u>
FACILITY NAME: <u>Carriage Cleaners</u>			
FACILITY LOCATION: <u>5675 Seminole Boulevard</u> <u>Seminole, FL, 33772</u>			
RESPONSIBLE OFFICIAL: <u>Clark Gamble</u>		PHONE: <u>(727) 392-2175</u>	
CONTACT: <u>Clark Gamble</u>		PHONE: <u>(727) 392-2175</u>	

PART I: NOTIFICATION

(Check appropriate box)

1. Existing facility notified DARM By 9/1/96	<input checked="" type="checkbox"/>
2. New facility notified DARM 30 days prior to startup	<input type="checkbox"/>
3. Facility failed to notify DARM to use general permit	<input type="checkbox"/>

PART II: CLASSIFICATION

Facility indicated on notification form that it is:
(Check appropriate box)

<p>A.</p> <p>1. Existing small area source <input type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed before 12/9/91)</p> <p>3. Existing large area source <input checked="" type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed before 12/9/91)</p>	<p><input type="checkbox"/> No notification form</p> <p><input type="checkbox"/> Drop store / out of business / petroleum</p> <p>2. New small area source <input type="checkbox"/> dry-to-dry only, x < 140 gal/yr transfer only, x < 200 gal/yr both types, x < 140 gal/yr (Constructed on or after 12/9/91)</p> <p>4. New large area source <input type="checkbox"/> dry-to-dry only, 140 < x < 2,100 gal/yr transfer only, 200 < x < 1,800 gal/yr both types, 140 < x < 1,800 gal/yr (Constructed on or after 12/9/91)</p>
---	--

This is a correct facility classification: Y N Can not determine

If no, please check the appropriate classification:

facility qualified for a general permit as number _____ above

facility exceeds above limits and is not eligible for a general permit

B. The total quantity of perchloroethylene (perc) purchased within the preceding 12 months by this dry cleaning facility was 122 gallons.

PART III: GENERAL CONTROL REQUIREMENTS

Is the responsible official of the dry cleaning facility:
(check appropriate boxes)

- | | | | |
|--|---------------------------------------|----------------------------|--|
| 1. Storing perchloroethylene in tightly sealed and impervious containers? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 2. Examining the containers for leakage? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 3. Closing and securing machine doors except during loading/unloading? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 4. Draining cartridge filters in their housing or in sealed containers for at least 24 hours prior to disposal? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 5. Maintaining solvent-to- carbon ratios and steam pressure for carbon adsorber beds according to the manufacturer's specifications? | <input type="checkbox"/> Y | <input type="checkbox"/> N | <input checked="" type="checkbox"/> NA |

PART IV: PROCESS VENT CONTROLS

In Part II-A:

If classification (1) has been checked, no controls are required. Proceed to Part V.

If classification (2) has been checked, the machine should be equipped with a refrigerated condenser (complete A below)

If classification (3) has been checked, the machine should be equipped with either a refrigerated condenser or a carbon adsorber (complete A and B below). Carbon adsorber must have been installed prior to September 22, 1993.

If classification (4) has been checked, the machine should be equipped with a refrigerated condenser (complete A and B below.)

A. Has the responsible official of all new sources and existing large area sources: (check appropriate boxes)

- | | | | |
|--|---------------------------------------|----------------------------|-----------------------------|
| 1. Equipped all machines with the appropriate vent controls? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 2. Equipped dry-to-dry machines with a closed-loop vapor venting system? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 3. Equipped the condenser with a diverter valve so airflow will be directed away from the condenser upon opening the door? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 4. Measured and recorded the temperature of the outlet exhaust stream of a refrigerated condenser on a <u>weekly</u> bi-weekly basis? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |
| 5. Repaired or adjusted the equipment within 24 hours if the exhaust temperature of the condenser exceeded 45°F? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | <input type="checkbox"/> NA |
| 6. Conducted all temperature monitoring after an appropriate cool down period and after verifying the coolant had been completely charged? | <input checked="" type="checkbox"/> Y | <input type="checkbox"/> N | |

B. Has the responsible official of an existing large or new large area source also:

1. Measured and recorded the exhaust temperature on the outlet side of the condenser located on dry-to-dry, reclaimer, and dryer machines on a weekly basis? Y N
2. Measured and recorded the washer exhaust temperature at the condenser inlet and outlet weekly? Y N NA
Is the temperature differential equal to or greater than 20° F? Y N NA
3. Measured and recorded the perc concentration in the exhaust stream weekly at the end of the final drying cycle while the machine is venting to the adsorber, if machines are equipped with a carbon adsorber? Y N NA
Is the perc concentration equal to or less than 100 ppm? Y N NA
4. Assured that the sampling port on the carbon adsorber exhaust for measuring perc. concentrations is at least 8 duct diameters downstream of any bend, contraction, or expansion; is at least 2 duct diameters upstream from any bend contraction, or expansion; and downstream from no other inlet? Y N NA
5. Equipped transfer machines (dryers, reclaimers, and washers) with individual condenser coils? Y N NA
6. Routed airflow to the carbon adsorber (if used) at all times? Y N NA

PART V: RECORDKEEPING REQUIREMENTS

Has the responsible official:
(check appropriate boxes)

1. Maintained receipts for perc purchased? Y N
2. Maintained rolling monthly averages of perc consumption? Y N
3. Maintained leak detection inspection and repair reports for the following:
- a. documentation of leaks repaired w/in 24 hrs? or; Y N NA
 - b. documentation of parts ordered to repair leak and leak repaired w/in 2 days and parts installed w/in 5 days of receipt? Y N NA
4. Maintained calibration data? (for direct reading instrument only) Y N NA
5. Maintained exhaust duct monitoring data on perc concentrations? Y N NA
6. Maintained startup/shutdown/malfunction plan? Y N
7. Maintained deviation reports? Y N NA
Problem corrected? Y N NA
8. Maintained compliance plan, if applicable? Y N NA

PART VI: LEAK DETECTION AND REPAIRS

1. Does the responsible official conduct a weekly (for small sources, bi-weekly) leak detection and repair inspection? Y N

2. Has the facility maintained a leak log? Y N

3. Does the responsible official check the following areas for leaks:

- | | | | |
|---|--|--------------------------|--|
| Hose connections, fitting couplings, and valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Muck cookers | <input type="checkbox"/> Y <input type="checkbox"/> N <input checked="" type="checkbox"/> NA |
| Door gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Stills | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Filter gaskets and seating | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Exhaust dampers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Pumps | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Diverter valves | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Solvent tanks and containers | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | Cartridge Filter housing | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA |
| Water separators | <input checked="" type="checkbox"/> Y <input type="checkbox"/> N <input type="checkbox"/> NA | | |

4. Which method of detection is used by the responsible official?
- Visual examination (condensed solvent of exterior surfaces)
 - Physical detection (airflow felt through gaskets)
 - Odor (noticeable perc odor)
 - Use of direct-reading instrumentation (FID/PID/calorimetric tubes)
 - Halogen leak detector

If using direct-reading instrumentation, is the equipment:

- a. Capable of detecting perc vapor concentrations in a range of 0-500 ppm. Y N
- b. Calibrated against a standard gas prior to and after each use (PID/FID only). Y N
- c. Inspected for leaks and obvious signs of wear on a weekly basis? Y N
- d. Kept in a clean and secure area when not in use. Y N
- e. Verified for accuracy by use of duplicate samples (calorimetric only)? Y N

Jeff Morris
Inspector's Name (Please Print)

12/15/00
Date of Inspection

Jeff Morris
Inspector's Signature

6/15/01
Approximate Date of Next Inspection

Z 210 662 981

US Postal Service
Receipt for Certified Mail

10 AIRS ID # 1030308001AG
 CLARK GAMBLE
 CARRIAGE CLEANERS INC
 5675 SEMINOLE BLVD
 SEMINOLE FL 34642

PS Form 3800, April 1995

Postage	\$
Certified Fee	
Special Delivery Fee	
Restricted Delivery Fee	
Return Receipt Showing to Whom & Date Delivered	
Return Receipt Showing to Whom, Date, & Addressee's Address	
TOTAL Postage & Fees	\$
Postmark or Date	

SENDER: COMPLETE THIS SECTION

- Complete items 1, 2, and 3. Also complete item 4 if Restricted Delivery is desired.
- Print your name and address on the reverse so that we can return the card to you.
- Attach this card to the back of the mailpiece, or on the front if space permits.

1. Article Addressed to:

AIRS ID # 1030308001AG
 CLARK GAMBLE
 CARRIAGE CLEANERS INC
 5675 SEMINOLE BLVD
 SEMINOLE FL 34642

Z 210 662 981

2. Article Number (Copy from service label)

COMPLETE THIS SECTION ON DELIVERY

A. Received by (Please Print Clearly) B. Date of Delivery

C. Signature Agent
 Addressee

D. Is delivery address different from item 1? Yes
 No

If YES, enter delivery address below:

JUN 11 2001
 Bureau of Air Monitoring
 & Mobile Sources

3. Service Type
 Certified Mail Express Mail
 Registered Return Receipt for Merchandise
 Insured Mail C.O.D.

4. Restricted Delivery? (Extra Fee) Yes

UNITED STATES POSTAL SERVICE



First-Class Mail
Postage & Fees Paid
USPS
Permit No. G-10

• Sender: Please print your name, address, and ZIP+4 in this box •

BUR. OF AIR MONITORING & MOBILE SOURCES
DEPT. OF ENVIRONMENTAL PROTECTION
MAIL STATION 5510
2600 BLAIR STONE ROAD
TALLAHASSEE, FLORIDA 32399-2400



THIS PORTION MUST BE ATTACHED TO REMITTANCE FOR PROPER HANDLING

0353703

Please include your AIRS ID# on your check or money order. This number can be found below on your mailing label.

TOTAL AMOUNT DUE: \$50.00

Do NOT Remove Label

AIRS ID # 1030308
 CARRIAGE CLEANERS INC
 CLARK GAMBLE
 5675 SEMINOLE BLVD
 SEMINOLE FL 34642

RECEIVED
 MAIL ROOM
 DEC 14 1998
 Bureau of Air Monitoring
 & Mobile Sources

FOR GOVERNMENT USE ONLY
 Org.: 37550101000 EO: B1
 Fund: 20-2-035001
 Obj.: 002273

THIS PORTION MUST BE ATTACHED TO REMITTANCE FOR PROPER HANDLING

300141

Please include your AIRS ID# on your check or money order. This number can be found below on your mailing label.

TOTAL AMOUNT DUE: \$50.00

Do NOT Remove Label

AIRS ID#1030308
 CARRIAGE CLEANERS INC
 CLARK GAMBLE
 5675 SEMINOLE BLVD
 SEMINOLE FL 34642

RECEIVED
 MAIL ROOM
 JAN 16 98

FOR GOVERNMENT USE ONLY
 Org.: 37550101000 EO: B1
 Fund: 20-2-035001
 Obj.: 002273

THIS PORTION MUST BE ATTACHED TO REMITTANCE FOR PROPER HANDLING

389225 ✓

Please include your AIRS ID# on your check or money order. This number can be found below on your mailing label.

TOTAL AMOUNT DUE: \$50.00

RECEIVED
MAIL ROOM
DEC - 9 99

Do NOT Remove Label

AIRS ID # 1030308
CARRIAGE CLEANERS INC CLARK GAMBLE 5675 SEMINOLE BLVD SEMINOLE FL 34642

FOR GOVERNMENT USE ONLY Org.: 37550101000 EO: B1 Fund: 20-2-035001 Obj.: 002273
--

THIS PORTION MUST BE ATTACHED TO REMITTANCE FOR PROPER HANDLING

258522 ✓

Please include your AIRS ID# on your check or money order. This number can be found below on your mailing label.

RECEIVED
MAIL ROOM

JAN 21 97

TOTAL AMOUNT DUE: \$50.00

Do NOT Remove Label

AIRS ID# 1030308
CARRIAGE CLEANERS CLARK GAMBLE 5675 SEMINOLE BLVD SEMINOLE FL 34642

FOR GOVERNMENT USE ONLY Org.: 37550101000 EO: B1 Fund: 20-2-035001 Obj.: 002273
--